

TIP TIG | USA

The Evolution of TIG



TIP TIG PORTABLE UNIT



TIP TIG SHOPUNIT

TIP TIG TECHNICAL MANUAL

V4.8.2

Preface

We are very pleased that you have chosen to place your trust in our product. We place great value in ensuring that you draw great pleasure, benefit and work enhancement from your use of the TIPTIG Hot Wire Unit.

For that reason, we would like you to read through the Technical Manual thoroughly before installing and starting to use the TIPTIG Hot Wire Unit.

It will help you to familiarize yourself with your new product as rapidly as possible and to use it more efficiently.

This Technical Manual details the TIPTIG Hot Wire Unit, providing you with assistance and support in installing it and getting started, as well as demonstrating how to use it safely and effectively

The Manual is structured as follows:

TABLE OF CONTENTS

SECTION I – SAFETY PRECAUTIONS - READ BEFORE USING		Pg
I-I	Symbol Usage	1
I-II	Arc Welding Hazards	1
I-III	Additional Symbols For Installation, Operation and Maintenance	2
I-IV	California Safety Standards	3
I-V	Principal Safety Standards	3
I-VI	EMF Information	3
SECTION II – Labels+symbols,Safety instruction especially TIPTIG		
II-I	Labelling+Symbols	4
II-II	Safety instructions (CE)	5
II-III	Safety instructions (CE)	6
II-IV	Safety instructions (CE)	7
SECTION III – Installation-Getting Started		
III-I	Installation/Getting Started	8
III-II	Getting Started	9
III-III	Getting Started	10
III-IV	What is the TIP TIG Process, How is it operated and Benefits	11
III-V	Wire Selection	12
III-VI	Tungsten Selection and Angles	13-14
III-VII	Teflon Wire Guide	15
III-VIII	Loading wire for the first time	16-19
SECTION IV – Introduction-Tips-Warnings		
IV-I	Introduction	20
IV-II	Tips II Function of TIP TIG Torch 18 SC	21-22
IV-III	Tips III Function of TIP TIG Interconnect Cable	23
IV-IV	Tips IV Function of Interface board	24
SECTION V – Pictures/Spare Part Number		
V-I	Front View TIP TIG	25
V-II	Left + Right Side TIP TIG	26
V-III	Parts list TIPTIG Hot Wire Unit	27
V-IV	Picture Inside Connection Hot Wire Module	28
V-V	Parts list Inside connection Hot Wire Module	29
V-VI	Wire Feeder Diagram	30-31
V-VII	Wire Feed Parts Breakdown	32
SECTION VI	Warranty	33
SECTION VII	WP18 SC LARGE / MEDIUM CONFIGURATION	34-35
SECTION VIII	WP20 SC LARGE / MEDIUM CONFIGURATION	36-37
SECTION IX	WP 18 / 20 Torch Instruction Guide	38-42

TABLE OF CONTENTS

SECTION X	WP 410 Straight (Handheld Addition)	43
SECTION XI	WP 410 Straight (Automation Addition)	44
SECTION XII	Automation Instruction Guide	45
SECTION XIII	TIP TIG FEEDER PC BOARD DIAGRAM	46
SECTION XIV	TIP TIG HOTWIRE CASE DIAGRAM	47 - 51
SECTION XV	Miller Maxstar / TIP TIG Setup	52
SECTION XVI	Miller Maxstar BASIC SETTINGS	53,54
SECTION XVII	TIP TIG Data Sheet	55
SECTION XVIII	Troubleshooting	56 - 60



Protect yourself and others from injury-read and follow these precautions

I - I **Symbol Usage**



Instead of the examination mark, the danger sign often shows the source of the danger in question. The yellow highlighted text contains details of how to prevent personal injury or substantial damage to property
Failure to comply with the instructions given may pose risk of injury 'or even danger of life!



This group of symbols means Warning! Watch Out!
ELECTRIC SHOCK,MOVING PARTS, and HOT PARTS hazards.
Consult symbols and related instructions below for necessary actions to avoid the hazards

NOTICE- Indicates statements not related to personal injury

I - II **Arc Welding Hazards**



The symbols shown below are used throughout this manual to call attention to and identify possible hazards. When you see the symbol, watch out, and follow the related instructions to avoid the hazard. The safety information given below is only a summary of he more complete safety information found in the Safety Standards listed in Section 1-V.Read and follow all Safety Standards



Only qualified persons should install,operate,maintain,and repair this unit



During operation, keep everybody, especially children, away.



ELECTRIC SHOCK can kill.

Touching live electrical parts can cause fatal shocks or severe burns. The electrode and work circuit is electrically live whenever the output is on. The input power circuit and machine internal circuits are also live when power is on. In semiautomatic or automatic wire welding, the wire, wire reel, drive roll housing and all metal parts touching the welding wire are electrically live. Incorrectly installed or improperly grounded equipment is a hazard.



Properly install and ground this equipment according to the Owner's Manual and national,state,and local codes.
Always verify the supply ground-check and be sure that input power cord ground wire is properly connected to ground terminal in disconnected box or that cord plug is connected to a properly grounded receptacle outlet.
When making input connections, attach proper grounding conductor- tor first-double-check connections.
Keep cords dry, free of oil and grease, and protected from hot metal and sparks.
Frequently inspect input power cord for damage or bare wiring- replace cord immediately if damaged-bare wiring can kill.
Turn off all equipment when not in use.
Do not use worn,damaged,undersized,or poorly spliced cables.
Do not drape cables over your body.
If earth grounding of the work piece is required, ground it directly with a separate cable.
Use only well-maintained equipment. Repair or replace damaged parts at once. Maintain according to manual.
Wear a safety harness if working above floor level.
Keep all panels and covers securely in place.
Clamp work cable with good metal-to-metal contact to work piece or worktable as near the weld as practical.
Insulate work clamp when not connected to workspace to prevent contact with any metal object.

Don't touch live electrical parts.

Wear dry, hole-free insulating gloves, and body protection

Insulate yourself from work and ground using dry insulating mats or covers big enough to prevent any physical contact with the of ground.

Do not use AC output in damp areas, if move, movement is confined, or if there is a danger of falling.

Use AC output ONLY if required for the welding process.

If AC output is required, remote output control is present on unit.

Additional safety precautions are required when any of the following electrically hazardous conditions are present: in damp locations or while wearing wet clothing; on metal structures such as floors,gratings,or scaffolds; when in cramped positions such as sitting,kneeling,or lying, or when there is a high risk of unavoidable or accidental contact with the work piece or ground.

Disconnected input power or stop engine before installing or servicing this equipment. Lockout/tag out input power according to OSHA 29 CFR 1910.147 (see Safety Standards).



HOT PARTS can burn.

Do not touch hot parts bare handle.
Allow cooling period before working on equip- ment.
To handle hot parts, use proper tools and/or wear heavy, insulated welding gloves and clothing to prevent burns.

SECTION I

I - III Additional Symbols For Installation,Operation,And Maintenance



FIRE OR EXPLOSION hazard.

Do not install or place unit on,over,or near combustible surfaces
Do not install unit near flammables.


Do not overload building wiring, be sure power supply system is properly sized, rated, and protected to handle this unit



FALLING EQUIPMENT can injure.

Use lifting eye to lift unit only, NOT running gear, gas cylinders, or any other accessories.
Use equipment of adequate capacity to lift and support unit.

If using lift forks to move unit, be sure forks are long enough to extend beyond opposite side of unit.
Keep equipment (cables and cords) away from moving vehicles when working from an aerial location
Follow the guideline in the Applications Manual for the Revised NIOSH Lifting Equation (publication No.94-110) when manually heavy parts or equipment.

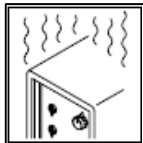

OVERUSE can cause OVERHEATING


Allow cooling period, follow rated duty cycle
Reduce current or reduce duty cycle before starting to weld again
Do not block or filter airflow to unit.



FLYING SPARKS can injure.

Wear a face shield to protect eyes and face
Shape tungsten electrode only on grinder with proper guards in a safe location wearing proper face, hand, and body protection.

Sparks can cause fires-keep flammables away.

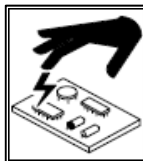

STATIC (ESD) can damage PC boards

Put on grounded wrist strap BEFORE handling boards or parts.
Use proper static-proof bags and boxes to store, move, or ship PC boards.




MOVING PARTS can injure.

Keep away from moving parts
Keep away from pinch points such as drive rolls.



WELDING WIRE can injure.

Do not press gun trigger(button) until instructed to do so.
Do not point gun toward any part of body, other people, or any metal threading welding wire

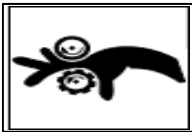

MOVING PARTS can injure.

Keep away from moving parts such as fan
Keep all doors, panels, covers and guards closed and securely in place

Have only qualified persons remove doors, panels, covers, or guards for maintenance and troubleshooting as necessary.
Reinstall doors, panels, covers or guards when maintenance is finished and before reconnecting input power.



READ INSTRUCTIONS

Read and follow all labels and the Owner's Manual carefully before installing, operating or servicing unit. Read the safety information at

the beginning of the manual and in each section
Use only genuine replacement parts from the manufacturer.
Perform maintenance and service according to the Owner's Manuals, industry standards, and national, state, and local codes



H.F. RADIATION can cause interference.

High-frequency (H.F.) can interfere with radio navigation, safety services, computers, and communications equipment.

Have only qualified persons familiar with electronic equipment perform this installation

The user is responsible for having a qualified electrician promptly correct any interference problem resulting from the installation
If notified by the FCC about interference, stop using the equipment at once.

Have the installation regularly checked and maintained.
Keep high-frequency source doors and panels tightly shut, keep sparks gaps at correct setting, and use grounding and shielding to minimize the possibility of interference.

SECTION I

I - IV CALIFORNIA PROPOSITION 65 WARNINGS



Welding or cutting equipment produces fumes or gases which contain chemicals known to the State of California to cause birth defects and ,in some cases, cancer,
(California Health & Safety Section 25249.5 et.seq.)

I - V Principal Safety Standards

Safety in Welding,Cutting,and Allied Processes
ANSI StandardZ49.1 from Global Engineering Documents
(www.global.ihs.com)

Safety in Welding,Cutting,and Allied Processes
CSA Standard W 117.2 from Canadian Standards Association
(www.csa-international.com)

OSHA,Occupational Safety and Health Standards for General Industry
Title 29,Code of federal Regulations(CFR) Part 1910,Subpart Q and Part 1926,SubpartI from Government Printing Office
(www.osha.gov)

I - VI EMF Information

- Electric current flowing through any conductor causes localized electric and magnetic fields(EMF). Welding current creates an EMF field around the welding circuit and welding equipment. EMF fields may interfere with some medical implants, e.g. peacemakers. Protective measures for persons wearing medical implants have to be taken. For example, access restrictions for passers-by or individual risk assessment for welders. All welders should use the following procedures in order to minimize exposure to EMF fields from the welding circuit:
1. Keep cables close together by twisting or taping them, or using a cable cover.
 2. Do not place your body between welding cables. Arrange cables to one side and away from the operator
 3. Do not coil or drape cables around your body
 4. Keep head an trunk as far away from the equipment in the welding circuit as possible.
 5. Connect work clamp to work piece as close to the weld as possible.
 6. Do not work next to, sit or lean on the welding power source.
 7. Do not weld whilst carrying the welding power source or wire feeder.

Symbols used in the Manual

This Technical manual uses a range of symbol and pictograms. You will need to familiarize yourself closely with their meanings. The symbols will help you to understand the information presented more rapidly and point out of potentially important information, hints and tips. Pay attention to the instructions and information presented adjacent to these symbols with particular care

Danger sign



Instead of the examination mark, the danger sign often shows the source of the danger in question. The yellow highlighted text contains details of how to prevent personal injury or substantial damage to property. Failure to comply with the instructions given may pose risk of injury -or even danger of life!

Prohibition sign



The prohibition sign often shows the action or object which is prohibited. The text accompanying this symbol details things to be avoided in order to prevent personal injury or damage to property.

Essential action sign



The action required (such as wearing protective equipment) is detailed in in place of exclamation mark. Identifies essential action to be taken in order to prevent injury.

Caution sign



The text accompanying this symbol details action to be taken in order to prevent damage.

Information sign



Note, information or tip as a help in enhancing use of the equipment

Hand book sign



Read the instructions-For your own safety and to avoid risk, be sure to read and follow the instructions set out in this Technical Manual

General safety instructions



The recognized technical rules and applicable standards and regulations were followed and applied in the development and manufacture of the TIPTIG High Speed Hot Wire Unit.

The TIPTIG High Speed Hot Wire Unit is designed and manufactured such that, if used in accordance with it's designed purpose, any potential danger is largely avoided.

Ing.Siegfried Plasch nonetheless feels obliged to detail the following safety precautions which you should undertake in order to avoid any residual risk

Follow the operating instructions!



Caution! When using TIPTIG Hot Wire Unit, the following fundamental safety precautions must be taken in order to protect against electric shock, potential injury and fire risk. Read and follow the instructions for use, cleaning, care and maintenance given in this Technical Manual before beginning work. Keep the Technical Manual within easy reach of the machine operator and pass it on to new operators as and when appropriate



The TIPTIG High Speed Hot Wire Unit is only for commercial and industrial use. Any other use of this machine must be authorized in writing by the manufacturer-Ing.Siegfried Plasch. Only personnel that have trained for use and servicing of welding equipment may operate this machine The operator for this equipment must carefully read and fully understand all the information contained within before the unit can be put into operation!
The information contained in this manual has been given the manufacturer's best knowledge. However, the manufacturer can't be held liable for the use of this information
Ing.Siegfried Plasch reserves the right to make any changes to this machine and/or operations manual without prior notice.

Check function!



Before beginning work, check that the guards and the TIPTIG Hot Wire Unit itself are in good working order. Check the torch and machine for damage and make sure that all parts in good working order!

Look out for damage!



All parts must be correctly fitted and all conditions to met ensure trouble-free operation of the machine. If the machine is damaged in any way, it must no longer be used. In such cases, ensure that the machine is professionally repaired. Identify the defect and mark the machine clearly so that it is not used until such time as the repair has been carried out.

Maintain good order!



Maintain good order in your work area! Disorder in a work area can cause accidents. Secure your workplace when leaving it.



Installation and servicing of the TIPTIG Hot Wire unit welding machines and components may only be performed in accordance with the national rules and regulations of the respective organization operators safety. Never come into contact with any metal parts that are under stress or use with bare hands or wet clothing. During welding operation always wear safety gloves, welding helmet with correct filter!

Be especially careful that anything, such as clothing that comes in contact with the work area including the welding torch, welding ground clamp and welding machine are always dry.

Never work in wet clothing!

When working with metal in the work area or in areas with high voltage always be sure that all metal parts are isolated. Always use dry gloves and wear rubber soled shoes!

Also, make sure that you are standing on a dry, isolated underlay!

Do not use any worn or damages welding cable!

Make sure that any welding cables are not overloaded!

Turn off the TIPTIG Hot Wire Unit and the welding machines if it is not in use for long periods of time!

Do not leave the welding cable coiled up and do not wrap it around any parts of the equipment casing!

When leaving the TIPTIG Hot Wire Unit and the welding unit, make sure that it has been turned off and never leave it running unattended!

Make sure that the welding ground is connected close by the welding area to the work piece!

Poor Welding ground connections, or poor grounding taken from parts of the building or remote points decrease efficiency.

Furthermore the risk of electrical damage to equipment will increase!

Make sure that welding voltage can not come into contact with any chains or steel ropes from equipment such as powered lifts and cranes!

Wear suitable work wear and personal safety gear!



Damaging effect of the rays generated by the electrical arc and from any hot metals can lead to severe burns to unprotected skin and eyes. To protect your eyes and body from damaging sparks and rays always use welding helmets with the proper certified filter lens. Also, wear the proper protective clothing etc., even if you are only observing the welding process Any person in the vicinity of the work area must be advised not to look directly into the arc and that metal sparks could be sent through the air.



Protect your skin and hair with leather gloves and a welding helmet/mask from the rays and metal sparks emitted.



Protect the personnel in the surrounding work area from the welding rays and hot sparks with approved anti-flame retardant gear.



Gas tanks under pressure are a potential danger. Follow all safety measures as suggested by gas suppliers and the safety procedures imposed by safety inspectors!


Make sure that gas tanks are in a safe place and cannot fall over!



Do not use the welding equipment close to flammable liquids or gases!

Danger from electrical energy!

There is electrical equipment inside the TIPTIG Hot Wire Unit. Check the machine for external damage before beginning work. Check especially if wires and cables are damaged.

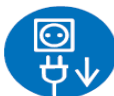

Do not continue working with the equipment if it is damaged.
Pull the plug! In the event of repairs and maintenance work, or when the equipment is not in use, always disconnect the mains power supply plug from wall socket



WARNING! Work on the electrical equipment may only be carried out by a qualified electrician. Only original spares may be used. Failure to comply with this requirement may result in users suffering accidents

Use only original parts!



WARNING! Use only spares as specified in this Manual. The use of non-approved parts may pose a risk of injury to you.

Make sure the correct power supply is connected!



The TIPTIG Hot Wire Unit must be connected to a socket outlet fitted with a properly installed ground contact.
Before connecting the TIPTIG Hot Wire Unit, make sure the main power cable and the plug are undamaged. Make sure the main voltage matches the specifications on the rating plate.
The TIPTIG Hot Wire Unit may only be connected to a voltage of 115/120VAC /50/60Hz.
The power circuit must be fuse-protected to a maximum of 16A.



Recommendation: To protect you against electric shock, the circuit should be protected by an GFI circuit-breaker(ground fault circuit-breaker)

The TIPTIG Hot Wire Unit can now be operated as detailed in the "Operator control" section

Using in tanks and container structures!









Don't take the TIPTIG Hot Wire Unit into a tank or container structure!
It's possible to take only the TIPTIG Feeder into any tank and container structure!
You have only to separate the TIPTIG Feeder from the TIPTIG Trolley!
In this case the operating supply voltage is only 32 VAC!

Getting start step 1

Connection step 2

Connection step 3



-  Connect the TIPTIG Hot Wire Unit interconnecting cable to welding machine.
-  Plug the TIPTIG Hot Wire Unit main cable plug to the socket
Only 115/120 VAC socket
-  Put the wire spool in the spool holder and secure the spool with the plastic nut an secure the plastic nut with the plastic screw!
-  Feed the wire by hand through the 4 feeder rollers and through out the central torch connector about 2 inches
-  Connect the TIPTIG torch to the TIPTIG feeder
-  Check that all connections are tight!

The Hotwire Power Switch is located in the front on the unit.
Press the I/O rocket switch to POWER ON the Hotwire Process.
If AC Welding. DO NOT USE HOTWIRE....Power Off Hotwire



When first Powered On, The LED Indicator light
will flash several times then become solid.
The Hot Wire Unit is activated.



The Hot Wire Amp Range is from 60 to 100.
80 Amps for .035 DIA Wire
100 Amps for .045 DIA Wire

What is the TIP TIG process?

The TIP TIG process is a dynamic GTAW process that combines our patented vibratory effect of the wire in part with a hotwire current applied to the wire prior to entering the weld puddle.

- The vibratory effect is created by a linear forward/backward mechanical motion created by the custom wire feeder system
- The Hotwire current is created by a secondary power source within the Tip Tig unit.

How is the TIP TIG Process Operated?

- The TIP TIG process is operated by using a standard solid core MIG spool, a conventional TIG power supply with a minimum of 350 amps with HF start and trigger hold function because the TIP TIG process doesn't use a foot pedal.
- The TIP TIG process can be operated in all welding positions both manually or combined with our automated equipment such as the TIP TIG Tractor, TIP TIG Orbital and TIP TIG Oscillator.

Weld Process Benefits from TIP TIG?

The wire entering the weld pool is mechanically and electrically superimposed from the TIP TIG process which creates a high speed vibration and preheating of the weld wire while entering the weld puddle.

The vibratory effect and the preheating of the wire create a more fluid weld puddle allowing for improved sidewall wetting and significant deposition rate increases as well as porosity off gassing.

Wire Selection for TIP TIG

- Always Use a Good Quality Weld Wire.
- The preferred wire diameter is .035 a secondary choice will be .045 based on wire type and availability.
- Plastic Reels are preferred over the Wire Steel Reels.
- Wire Steel Reels may Bend or Break Causing Wire Feed Problems.
- With TIP TIG the Wire Cast and Helix are Important for good Feedability.
- Use standard 10LB, 33LB , 40LB Wire Spools on 8" and 12" DIA.




Please visit Oxford Alloys at www.oxfordalloys.com for your wire selections.

Mild Steel, Stainless Steel, Duplex, Super Duplex, Nickel Alloy

Titanium, Bronze & Copper Wire


Binzel E3 Electrodes Run Much Cooler, Extending Tip Life!

Most commonly is used non-radioactive tungsten with long electrode life under heavy amperage loads. It has the ability to resist thermal shock which provides the user with excellent ignition with a lower burn off rate.

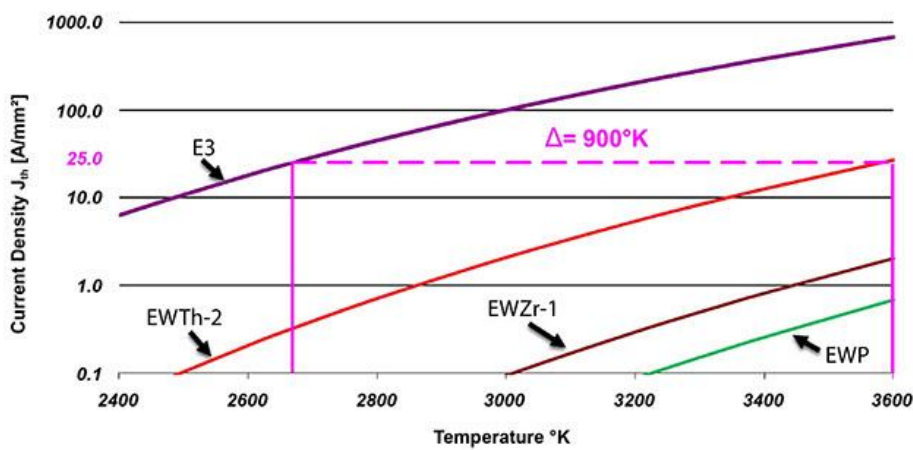

Tungsten Electrodes Sizes to Amperage Ranges


- 3/32" (.093") 2.4 mm = 60 - 250
- 1/8" (.125") 3.2 mm = 100 - 400
- 5/32" (.156") 4.0 mm = 160 - 500

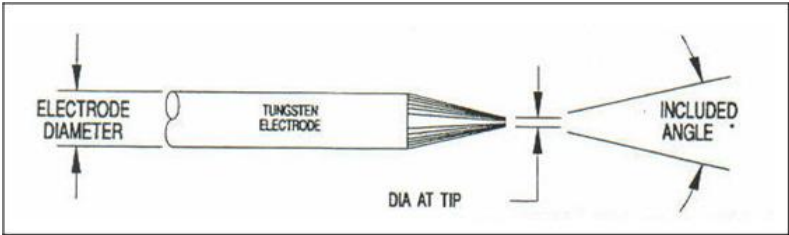


With the TIP TIG Process, you will be welding with more wire so your weld current will be higher than normal. 150 – 350 amps is typical. You will have much longer arc on times. How the tungsten is sharpened will have dramatic effect on the weld duty cycle attained.

For manual TIP TIG welds you want an included angle of “25 degree” with a flat on the tungsten tip. This provides a wider arc plasma suited for most TIG welds.

For better penetration at high travel rates, you will need a included angle of “35 degree”. This angle provides a narrow, more concentrated arc plasma better suited for automation.

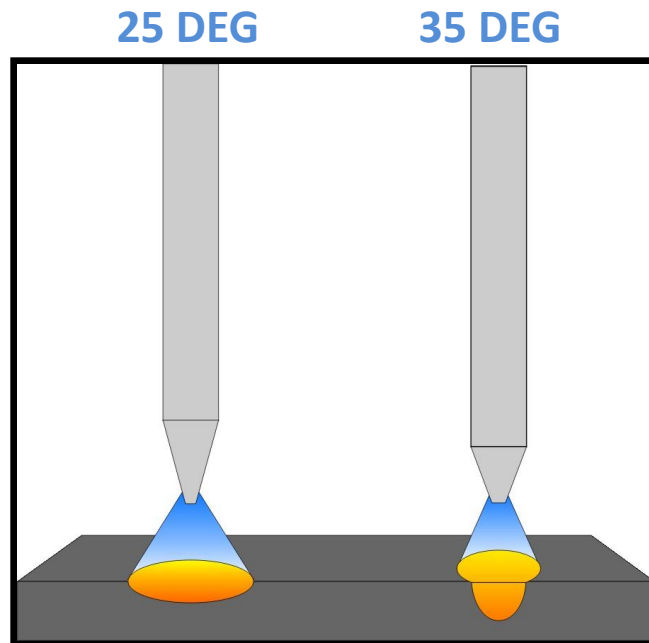

When removing or installing the torch, make sure the TIP TIG TEFLON OUTLET TUBE is installed inside the main connection terminal as shown below.

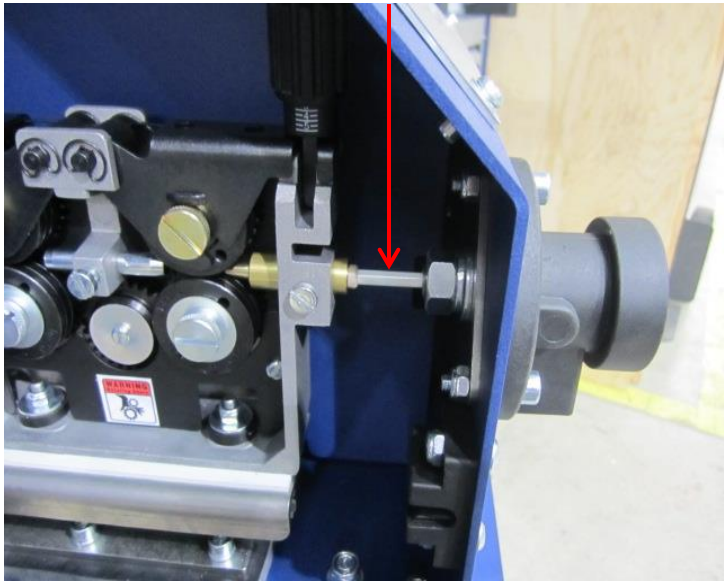

The TIP TIG TEFLON OUTLET TUBE is 4" Long.

The purpose of the TIP TIG TEFLON OUTLET TUBE is to keep the wire centered from the action of the wire feeder's forward and backwards motion and acts as the outlet guide for the wire.

To Install the TIP TIG BRASS GUIDE, see page 18

When installing a wire spool, make sure the drive wheels are set to the correct wire diameter.

Each drive wheel is reversible.
The number shown on the front side of the drive wheel indicates the correct wire size used.

Available Drive Roll Sizes (.8-1.0) (1.0-1.2) (1.2-1.6)

Drive Rolls labeled both
Metric / Standard Wire




.035 DIA Wire use
1.0mm Drive Rolls on Bottom
.8mm Drive Rolls on Top.



Hand Tighten all screws on the drive rolls
and make sure drive rolls are able to spin
freely.


When installing the upper drive wheels, make sure the metal tension spring is against the bracket before installing the drive wheel.

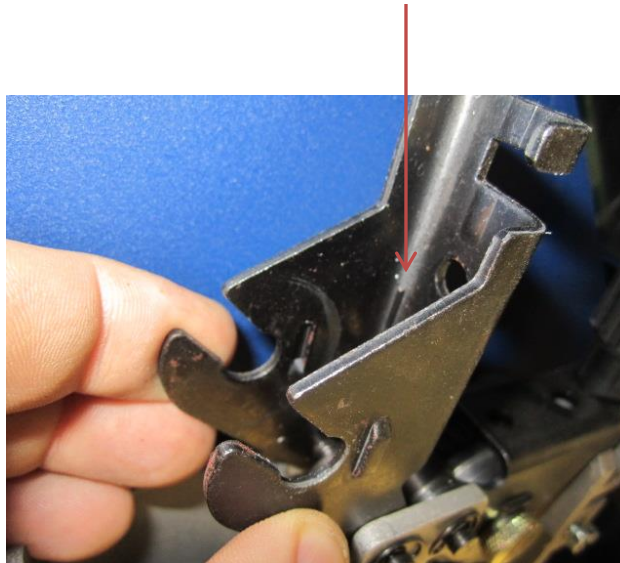

Set the Drive wheel Tension to 3 for most wire types

Make sure the Inlet Guide and the Outlet Guide are as close to the drive rolls as possible.


This will greatly reduce any wire feed issues.

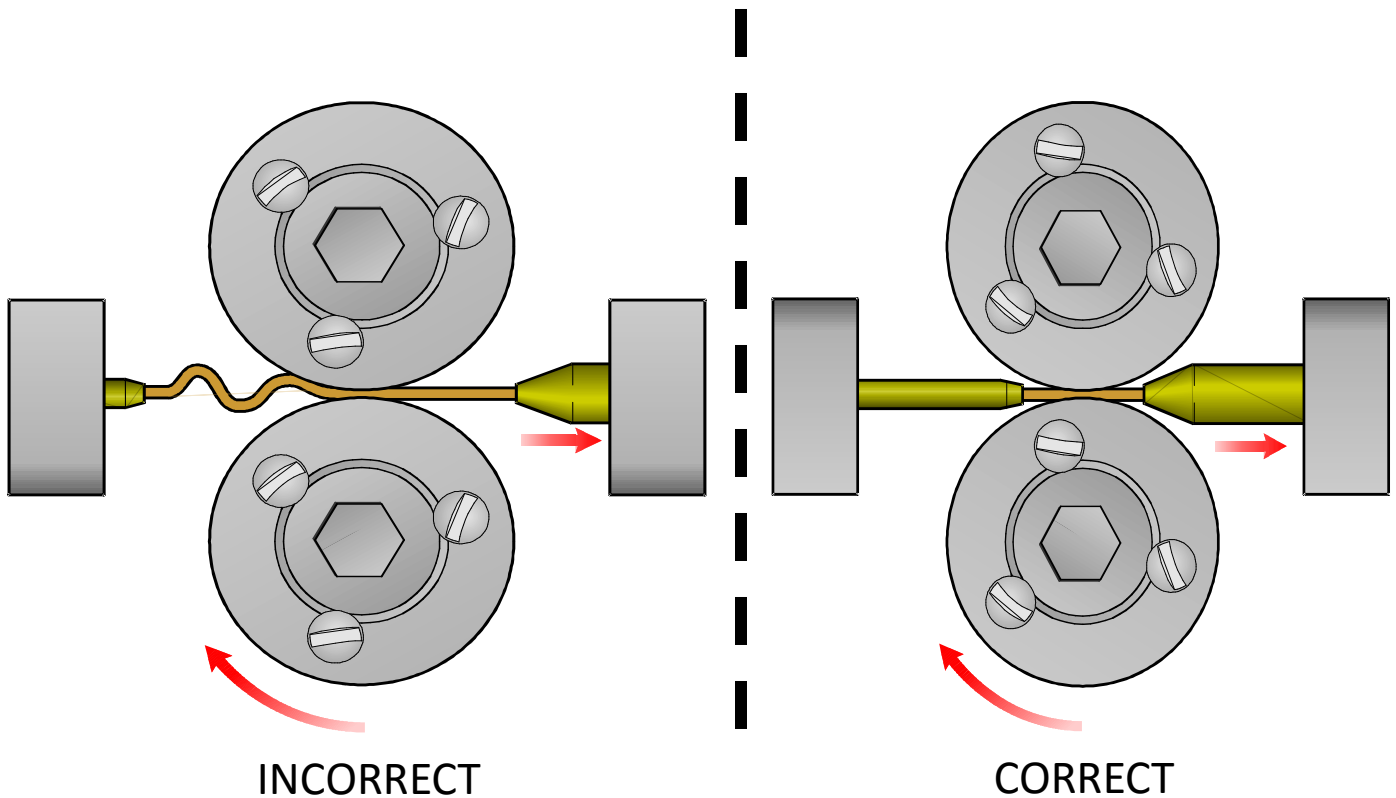







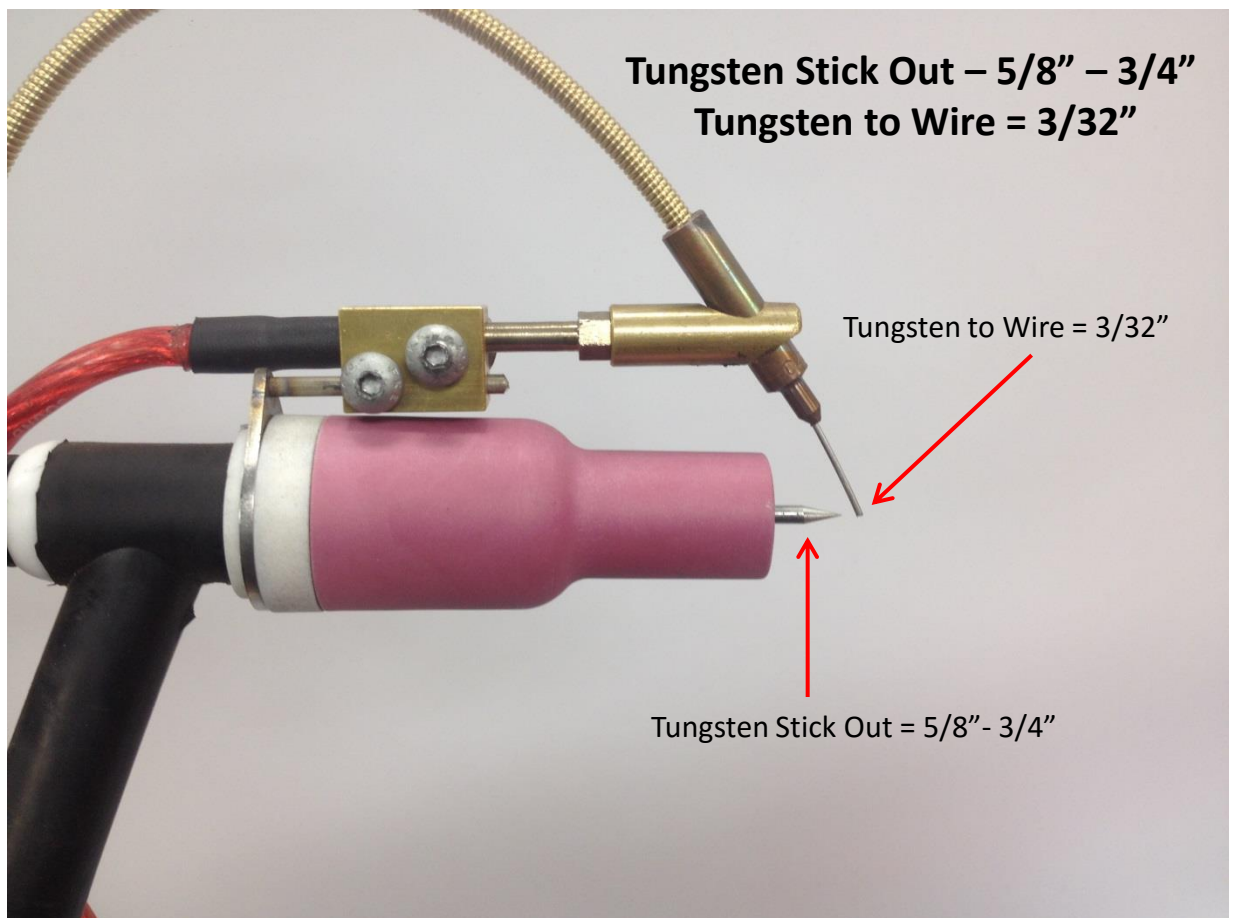



When installing the TIP TIG BRASS GUIDE, please ensure that the Brass guide is as close to the drive rolls without making contact with them. Refer to the correct diagram above.

Load Welding Wire on the TIP TIG

1. Remove all liner consumables so the torch is bare.
2. Make sure the correct drive rolls are installed.
3. Set the wire feed speed to 100.
4. Use a file to round off wire before inserting in into the TIP TIG.
5. Run the wire until it is about 12 inches past the handle.
6. Install liner and guide blocks...Make all settings as shown below.
7. Orientate the guide block to the desired position.
8. Run 15 inches of wire to ensure the wire cast has been straightened.
9. Set tensioners to around 3 and you are ready to weld.
10. Run the wire out for 30 seconds with the wire speed at 30 produce 45 linear inches of wire.
11. Adjust tension to achieve 45" of wire +/- 5 in 30 seconds



TIPTIG	 <p>TIPTIG Hot Wire Unit can be use for TIG/PLASMA/LASER techniques TIPTIG Hot Wire Unit is suitable for Hot and Cold Wire Welding All filler diameters can be used (0.030in-0.063in) For Aluminum it's recommended 0.045in (0.063in) Use the welding machines with the water cooler running. If not you will damage the torch.</p>
Display value feeding speed	 <p>The display value:- multiplied by 2.5 is the result in inches! Example: Factor 100 = 250inches/min (6.4m/min)!</p>
Display value frequency	 <p>The value is as shown as factor! For all applications use 230!!</p>
Display value start delay	 <p>The value is shown as factor! Useful for tack weld !</p>
Display value wire retract delay	 <p>The value is shown as a factor! Is an option -normally not used!</p>
Display value spot time	 <p>The value is shown as factor! Only for spot weld! To use spot time it's needed to adjust the mode spot function</p>
Mode 4 -step	 <p>Generally select 4- stroke mode for hand welding > see page 8</p>
Mode 2 -step	 <p>2- stroke mode mostly used for tack welding</p>
UP/DOWN Function Wire Feed Speed	 <p>If a remote control or an UP/DOWN torch is used, it's possible to adjust wire speed+- 33% from the setup of wire feed value</p>
Option UP/DOWN Function AMPS	 <p>If a remote control or an UP/DOWN torch is used, it's possible to adjust amps + -! This option belongs to the feature of the welding machine!</p>

TIPTIG Hotwire 18 Water Cooled Torch

Part Number # 10002461



NEW!!

TIPTIG EXTREME

Hotwire 18 Water Cooled Torch

Standard Length 14ft (4.25m)

Duty cycle 400A/100%



Up Function = Arc On and Off

Down Function = Wire On and Off

To Start the Weld process

Step 1 – Press Up Button to Start Arc


Step 2 – Press Down Button to Start Wire

To Stop the Weld Process

Step 3 – Press Down Button to Stop Wire

Step 4 – Press Up Button to Stop Arc

Connecting the Torch to the Feeder can only go ONE WAY!
See Pictures Below

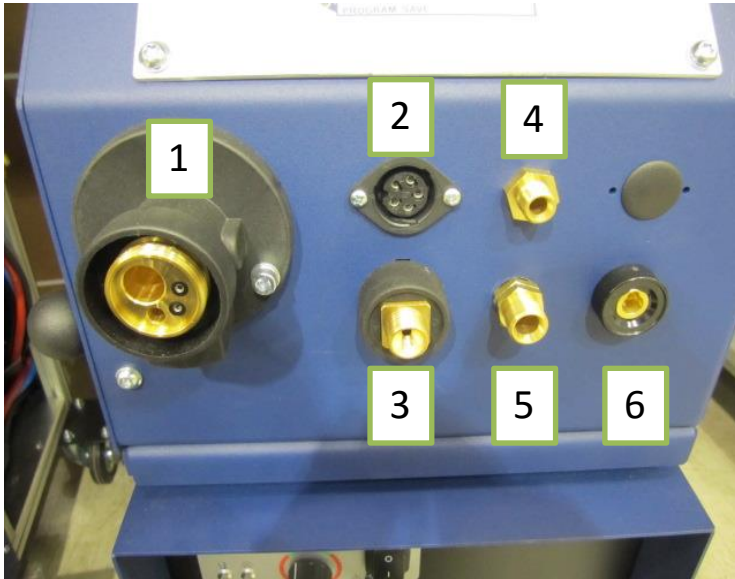


TIP TIG FEEDER

- 1 - Main Torch Connection Terminal
- 2 - 5 Pin Female Bajonet Connector
- 3 - Current / Water Connection G3/8 RH
- 4 - Gas Connection G1/4 RH
- 5 - Water Inlet Connection G3/8 LH
- 6 - Hotwire Terminal 25



TIP TIG TORCH

- 1 - Torch Connection
- 2 - 5 Pin Male Bajonet Connector
- 3 - Current / Water Connection G3/8 RH
- 4 - Gas Connection G1/4 RH
- 5 - Water Inlet Connection G3/8 LH
- 6 - Hotwire Terminal SK25

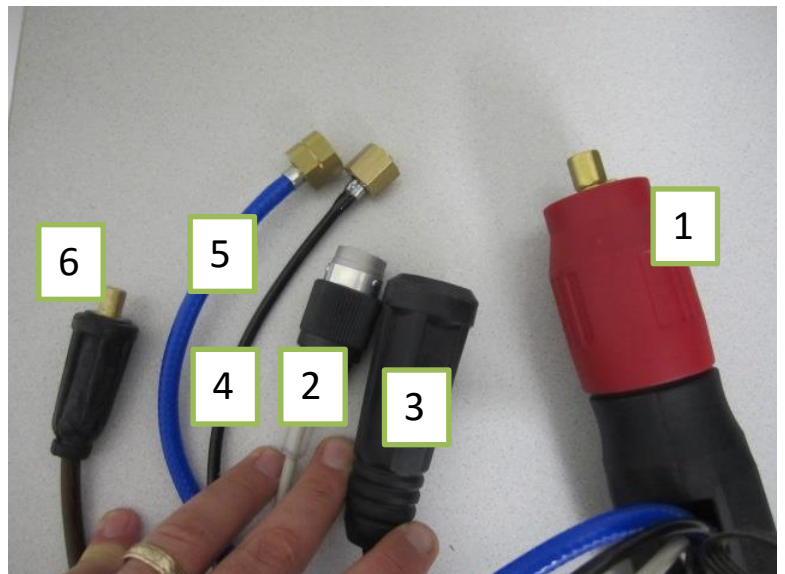

TIP TIG Interconnect Cable


NOTE: Cable Ends will be labeled with **RED** and **YELLOW** indicators to match the location on the Power Supply.

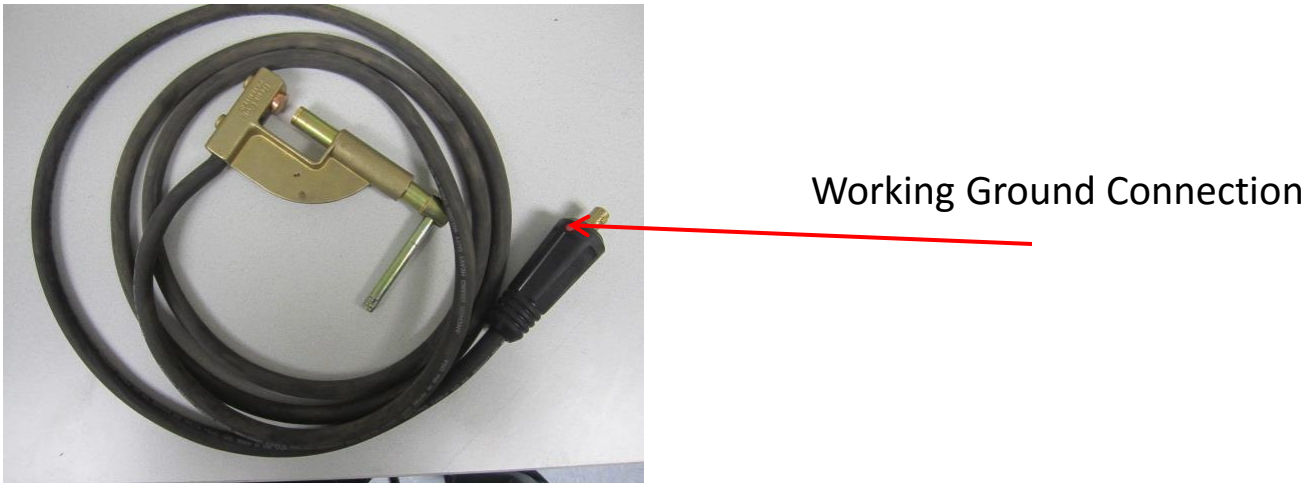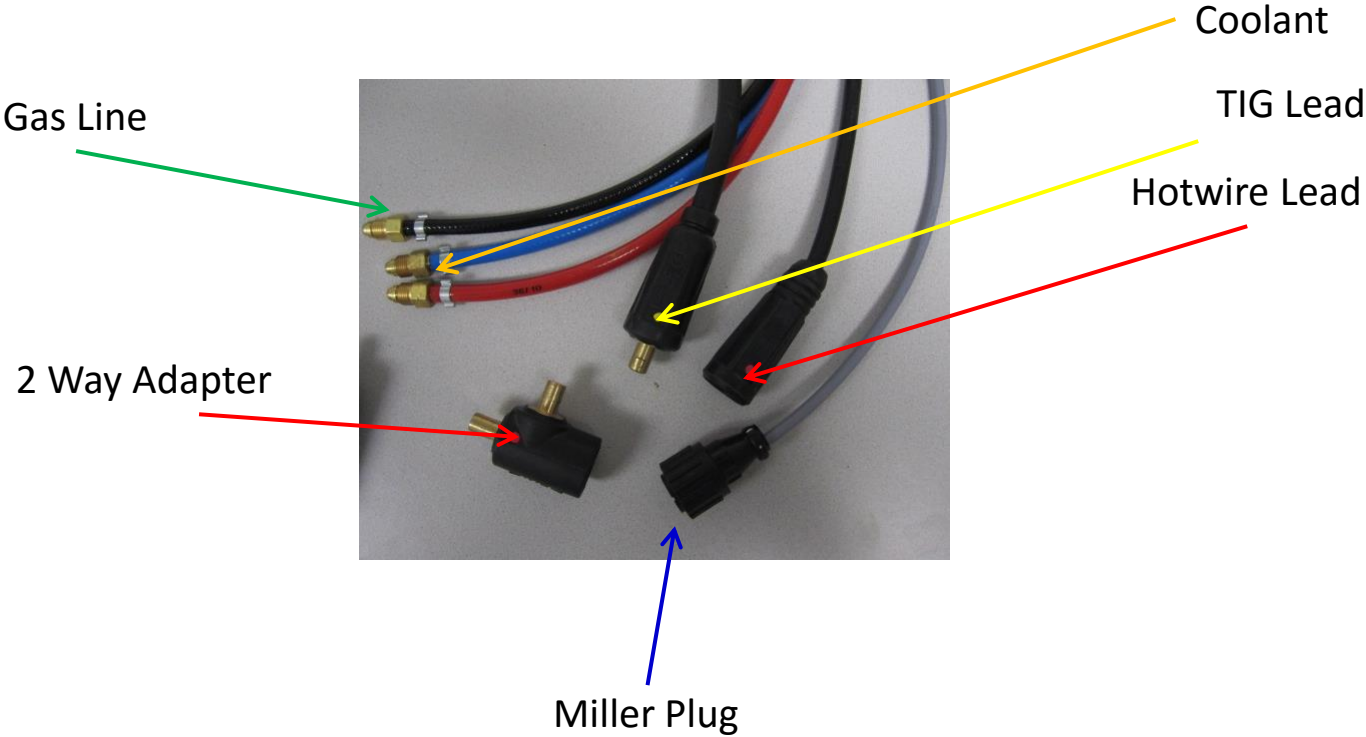


SECTION IV-V

TIPS III Function of Interface Board

Operating microprocessor control


 Function of the microprocessor control
How to adjust parameter



To choose parameter


 **Wire feed speed** F press
Oscillation frequency F press
Start delay F press
Wire retract time F press
Spot time F press





To change values



 **4-Stroke – Regular Welding** F press
2- Stroke – Tack Welding F press
Lead Voltage 0-10v (AUTO) F press
Spot Function F press
Program Load F press
Program Save

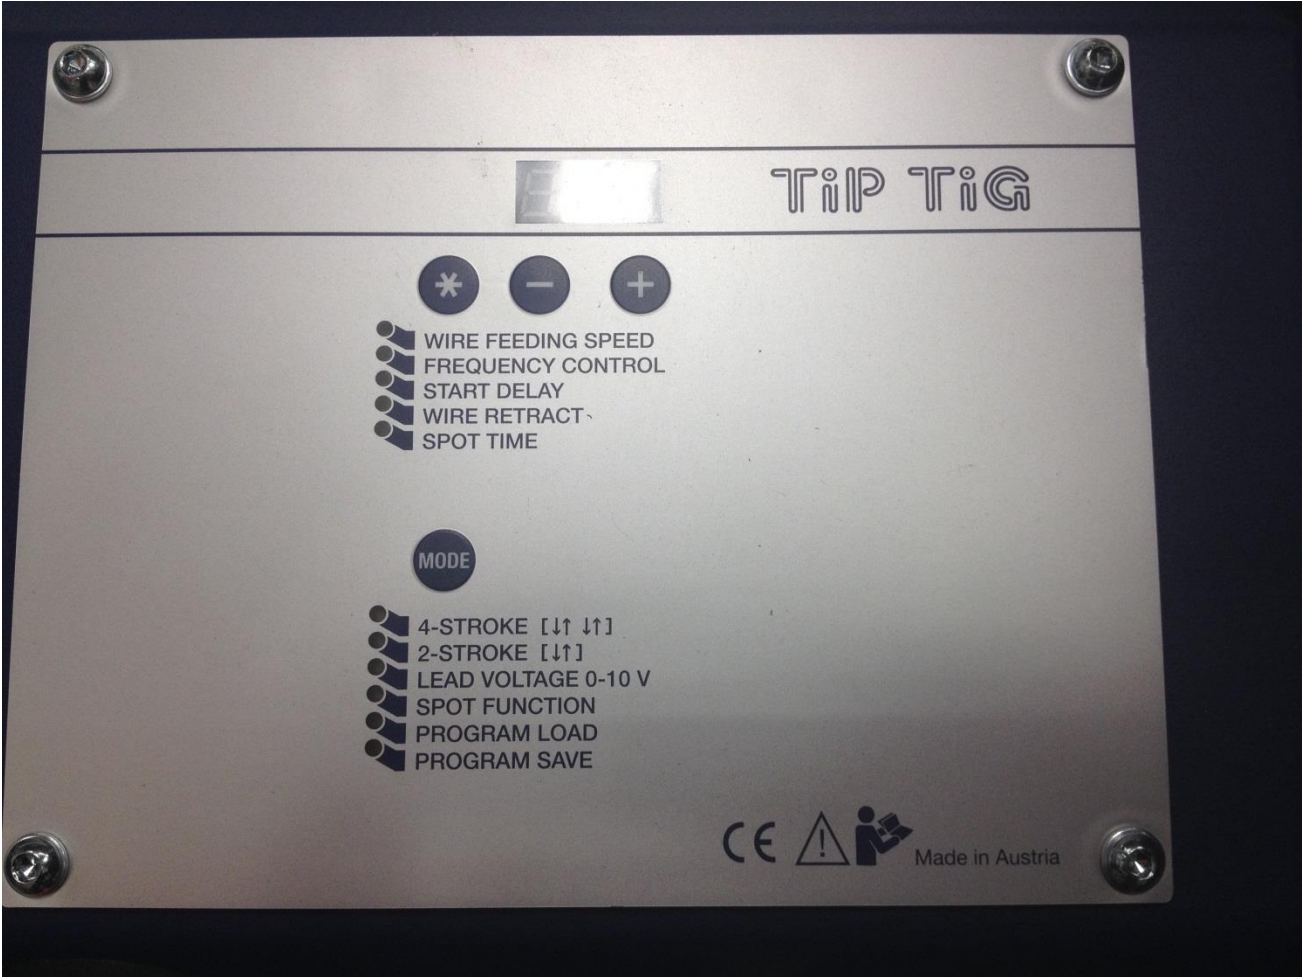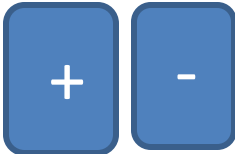




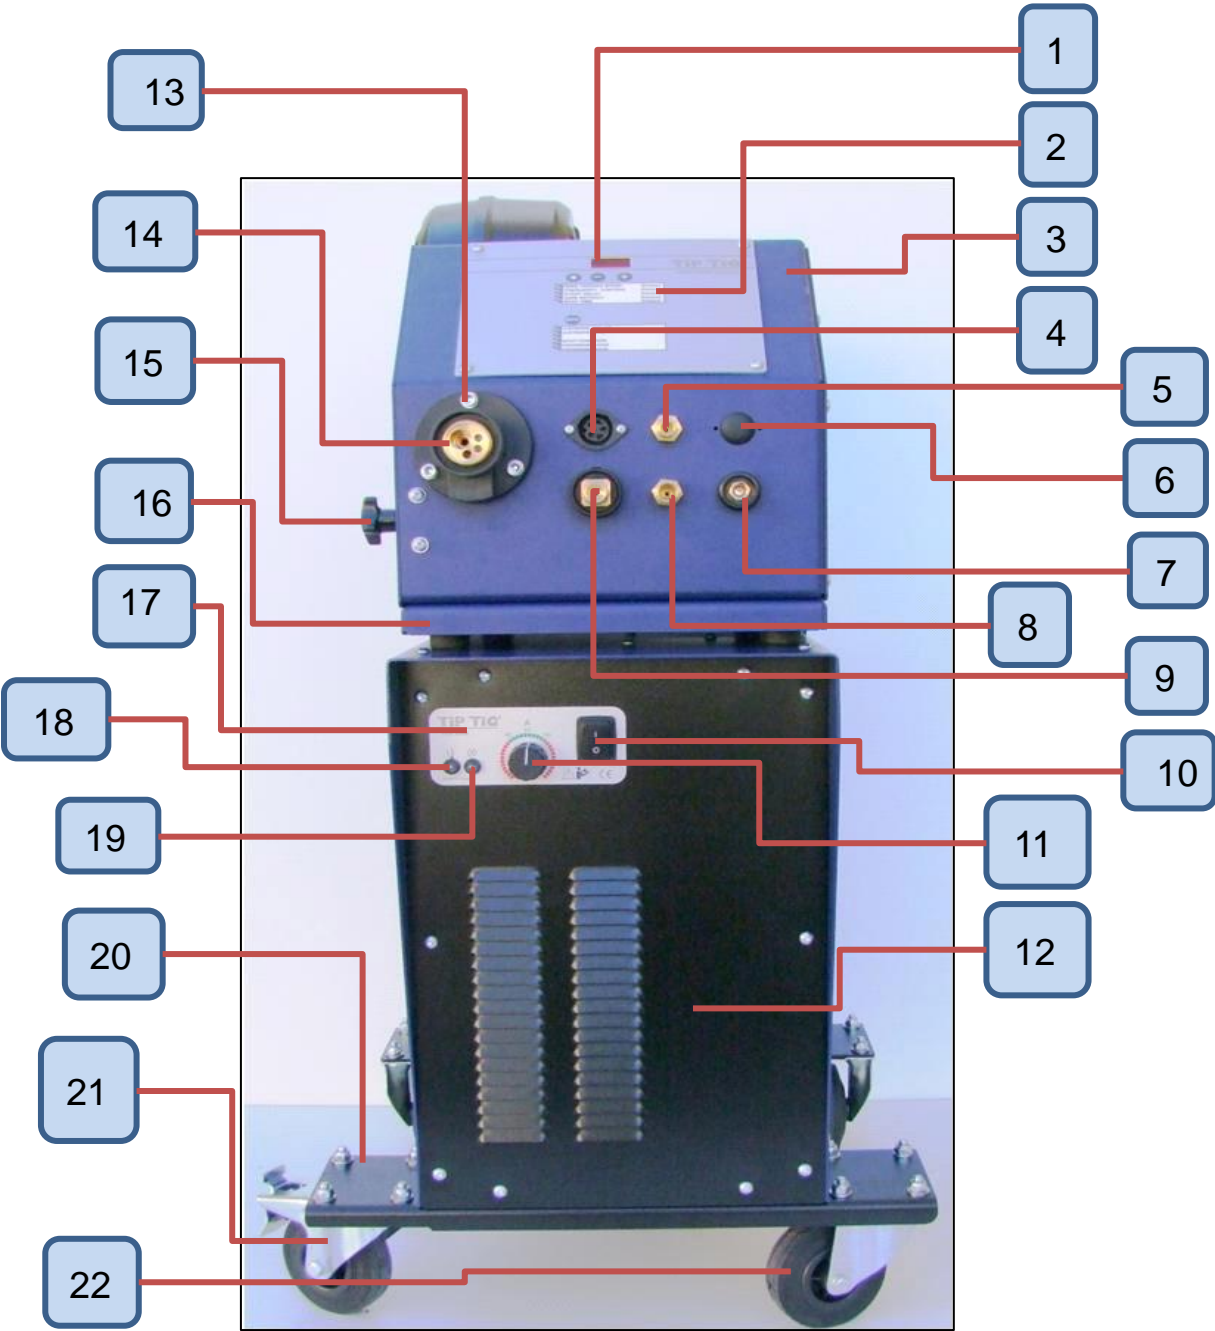


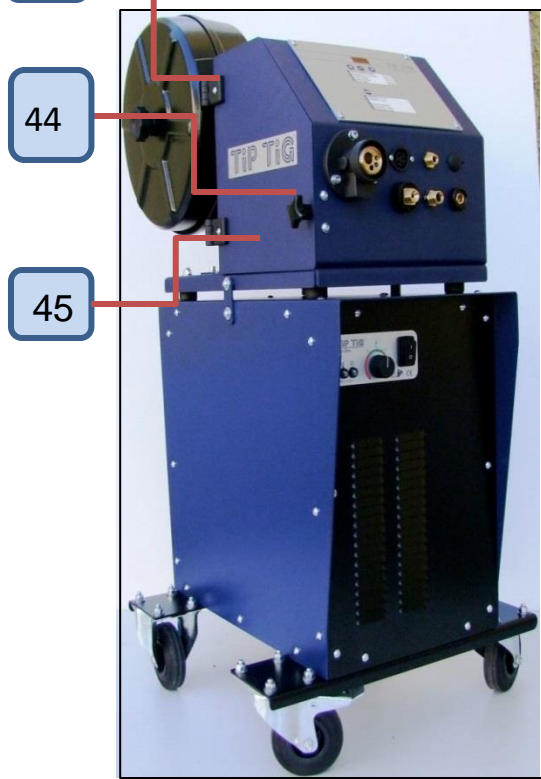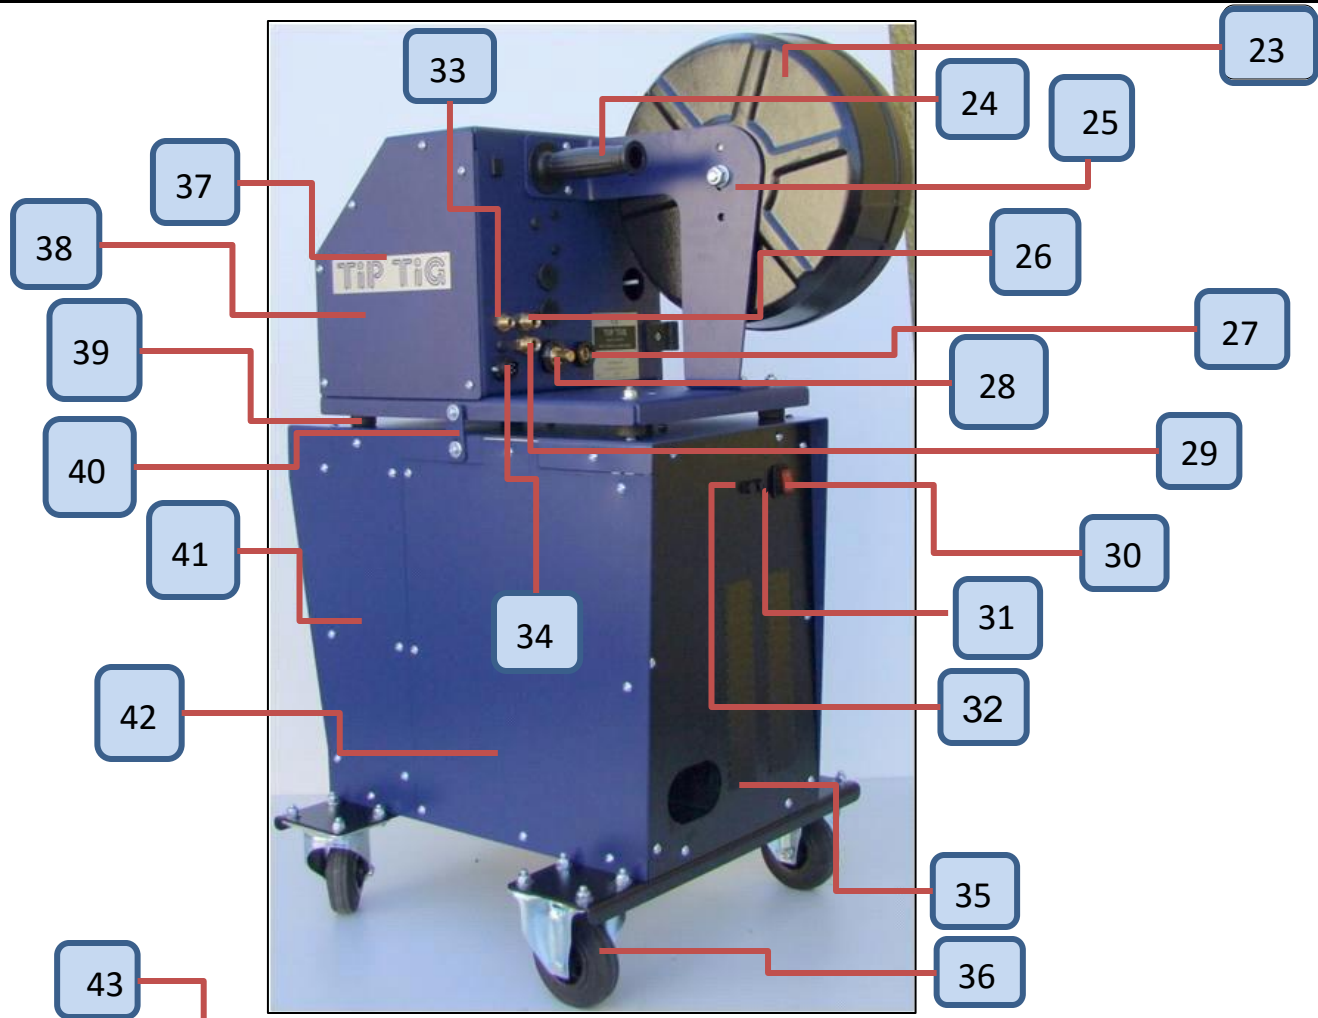


Pos		Description	Article no
1	1	pc TIP TIG Micro processor control hand version	77700106
2	1	pc TIP TIG Front plate new design	88800410
3	1	pc TIP TIG Case housing	88800690
4	1	pc TIP TIG Female socket 5-pin,bajonet connector	88800457
5	1	pc TIP TIG Male x Male connector with inner cone for gas G1/4" RH	88800430
6	1	pc TIP TIG Plastic blind nipple	77700190
7	1	pc TIP TIG Built in plug BEM 25	88800426
8	1	pc TIP TIG Male x Male connector with inner cone G3/8" LH	88800431
9	1	pc TIP TIG Water/current connection G3/8" right hand complete	77700162
10	1	pc TIP TIG Rocker switch without flash-IP 65	88800501
11	1	pc TIP TIG Pot knob for hot wire unit	88800510
12	1	pc TIP TIG Front plate hot wire module	88800862
13	1	pc TIP TIG Plastic mask	77700046
14	1	pc TIP TIG Torch central brass connector	77700048
15	1	pc TIP TIG Door knob	77700049
16	1	pc TIP TIG Basic plate	88800601
17	1	pc TIP TIG Label sticker Hot Wire Module	88800480
18	1	pc TIP TIG LED yellow	88800504
19	1	pc TIP TIG LED green	88800503
20	1	pc TIP TIG Plate for wheels	88800552
21	1	pc TIP TIG Steering roller with brake	88800555
22	1	pc TIP TIG Steering roller without brake	88800556
23	1	pc TIP TIG Plastic wire cover black	77700044
24	1	pc TIP TIG Plastic handle	77700690
25	1	pc TIP TIG Wire spool holder	88800620
26	1	pc TIP TIG Male x Male connector with inner cone for water G3/8" LH	88800431
27	1	pc TIP TIG Built in plug BEM 25	88800426
28	1	pc TIP TIG Built-in socket SE 50/70	88800428
29	1	pc TIP TIG Male x Male connector with inner cone for water G3/8" RH	88800432
30	1	pc TIP TIG Rocker switch with red flash-IP 65	88800500
31	1	pc TIP TIG Fuse holder IP 67	88800506
32	1	pc TIP TIG Plastic blind nipple	88800508
33	1	pc TIP TIG Male x Male connector with inner cone for gas G1/4" RH	88800430
34	1	pc TIP TIG Male socket 6+PE, screw termination (Series 693)	88800452
35	1	pc TIP TIG Case plate back hot wire module	88800860
36	2	pc TIP TIG Trestle roller	88800558
37	2	pc TIP TIG Sticker	88800560
38	1	pc TIP TIG Case plate right	88800635
39	4	pc TIP TIG Rubber feet	88800760
40	2	pc TIP TIG Grounding clip Hot Wire Module	88800866
41	1	pc TIP TIG Case housing Hot Wire Module	88800868
42	1	pc TIP TIG Right side cover plate Hot Wire Module	88800870
43	1	pc TIP TIG Screw wire cover	77700045
44	1	pc TIP TIG Door	88800632
45	1	pc TIP TIG Plastic hinge	88800755
46	1	pc TIP TIG Support for spool holder	88800750

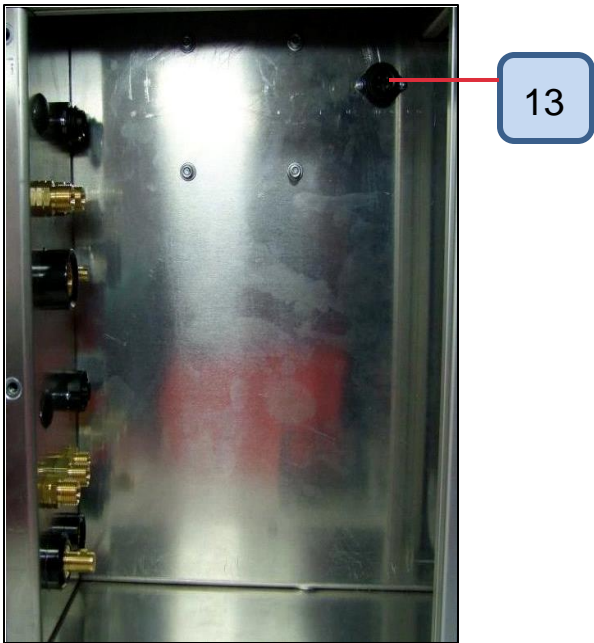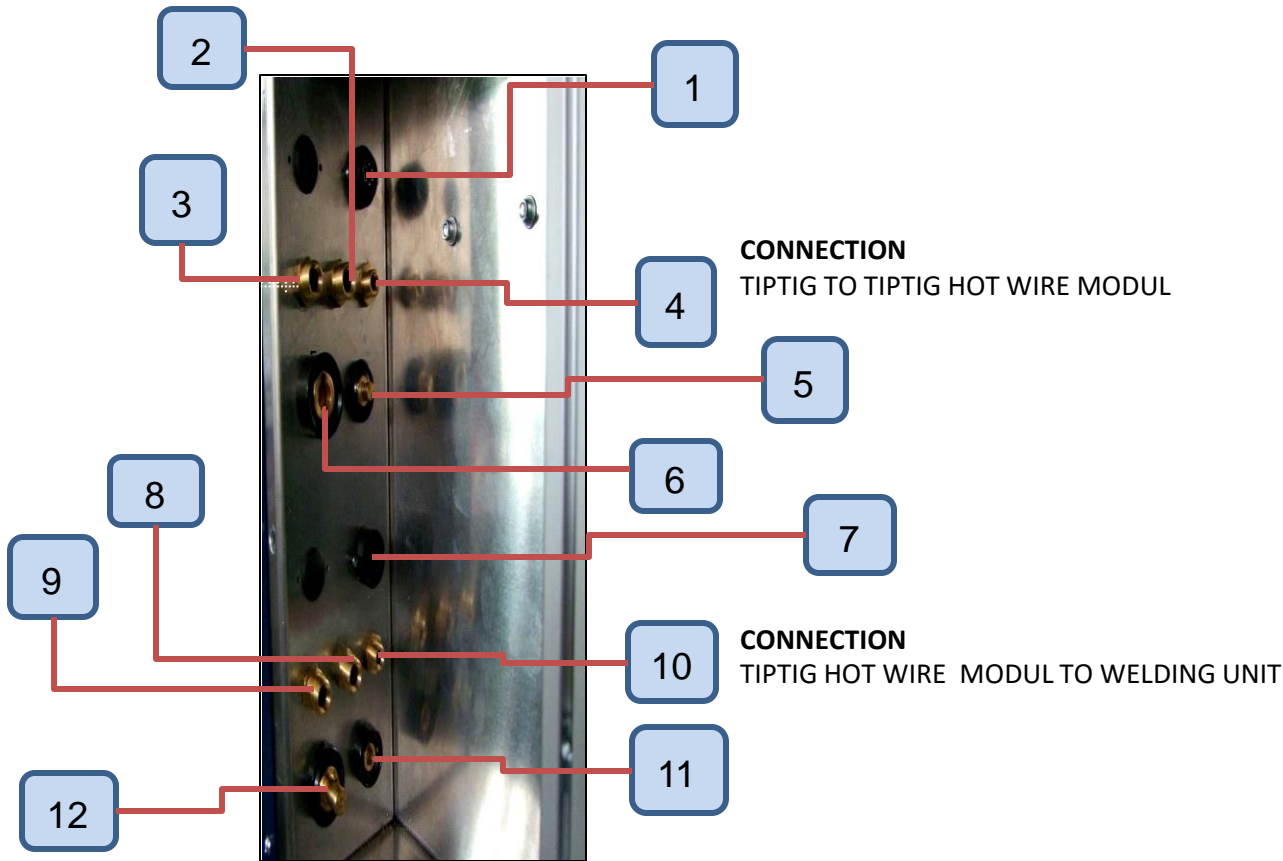

Pos			Description	Article no
1	1	pc	TIP TIG Male socket 6+PE, screw termination (Series 693)	88800452
2	1	pc	TIP TIG Male x Male connector with inner cone for water G3/8" LH	88800431
3	1	pc	TIP TIG Male x Male connector with inner cone for water G3/8" RH	88800432
4	1	pc	TIP TIG Male x Male connector with inner cone for gas G1/4" RH	88800430
5	1	pc	TIP TIG Built in plug SEM 25	88800454
6	1	pc	TIP TIG Built in plug BE 50/70	77700050
7	1	pc	TIP TIG Female socket 6+PE, screw termination (Series 693)	88800453
8	1	pc	TIP TIG Male x Male connector with inner cone for water G3/8" LH	88800431
9	1	pc	TIP TIG Male x Male connector with inner cone for water G3/8" RH	88800432
10	1	pc	TIP TIG Male x Male connector with inner cone for gas G1/4" RH	88800430
11	1	pc	TIP TIG Built in plug BEM 25	88800426
12	1	pc	TIP TIG Built-in socket SE 50/70	88800428
13	1	pc	TIP TIG Male socket 3+PE, screw termination (Series 693)	88800458

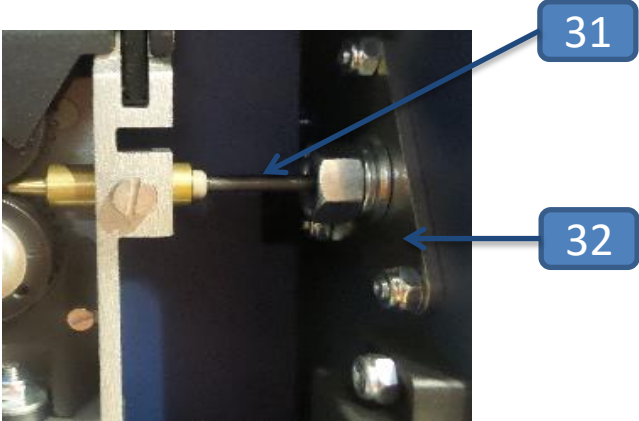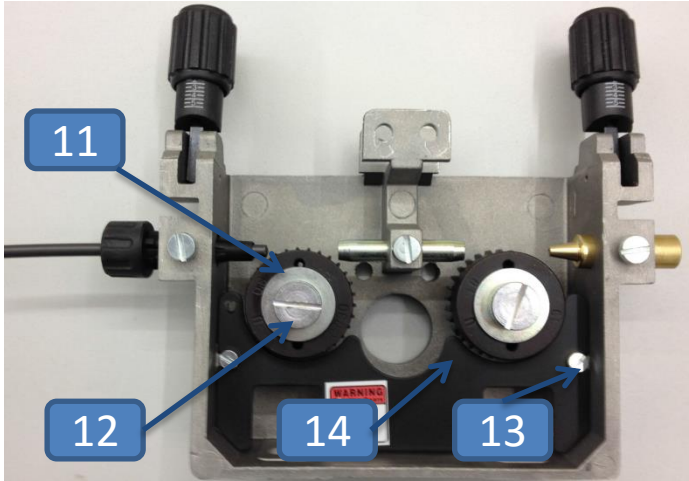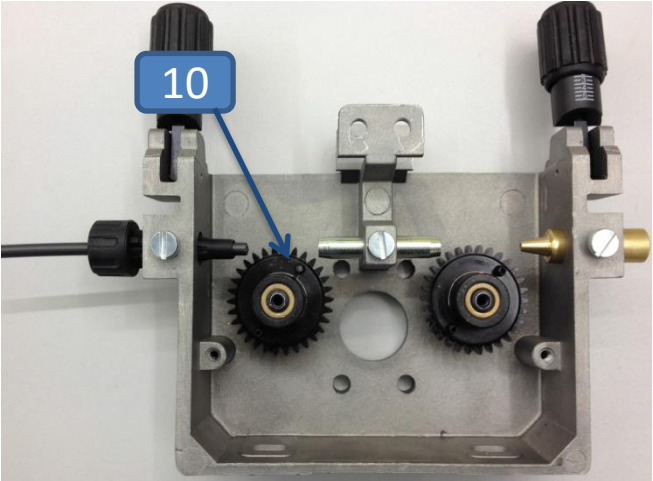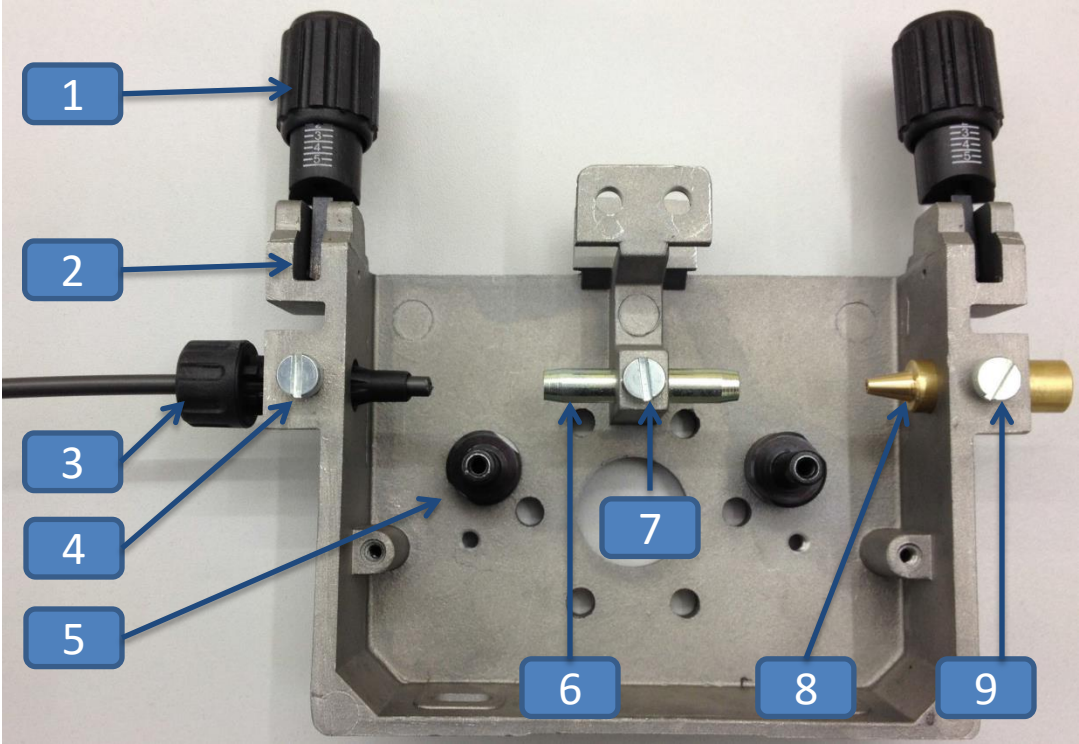

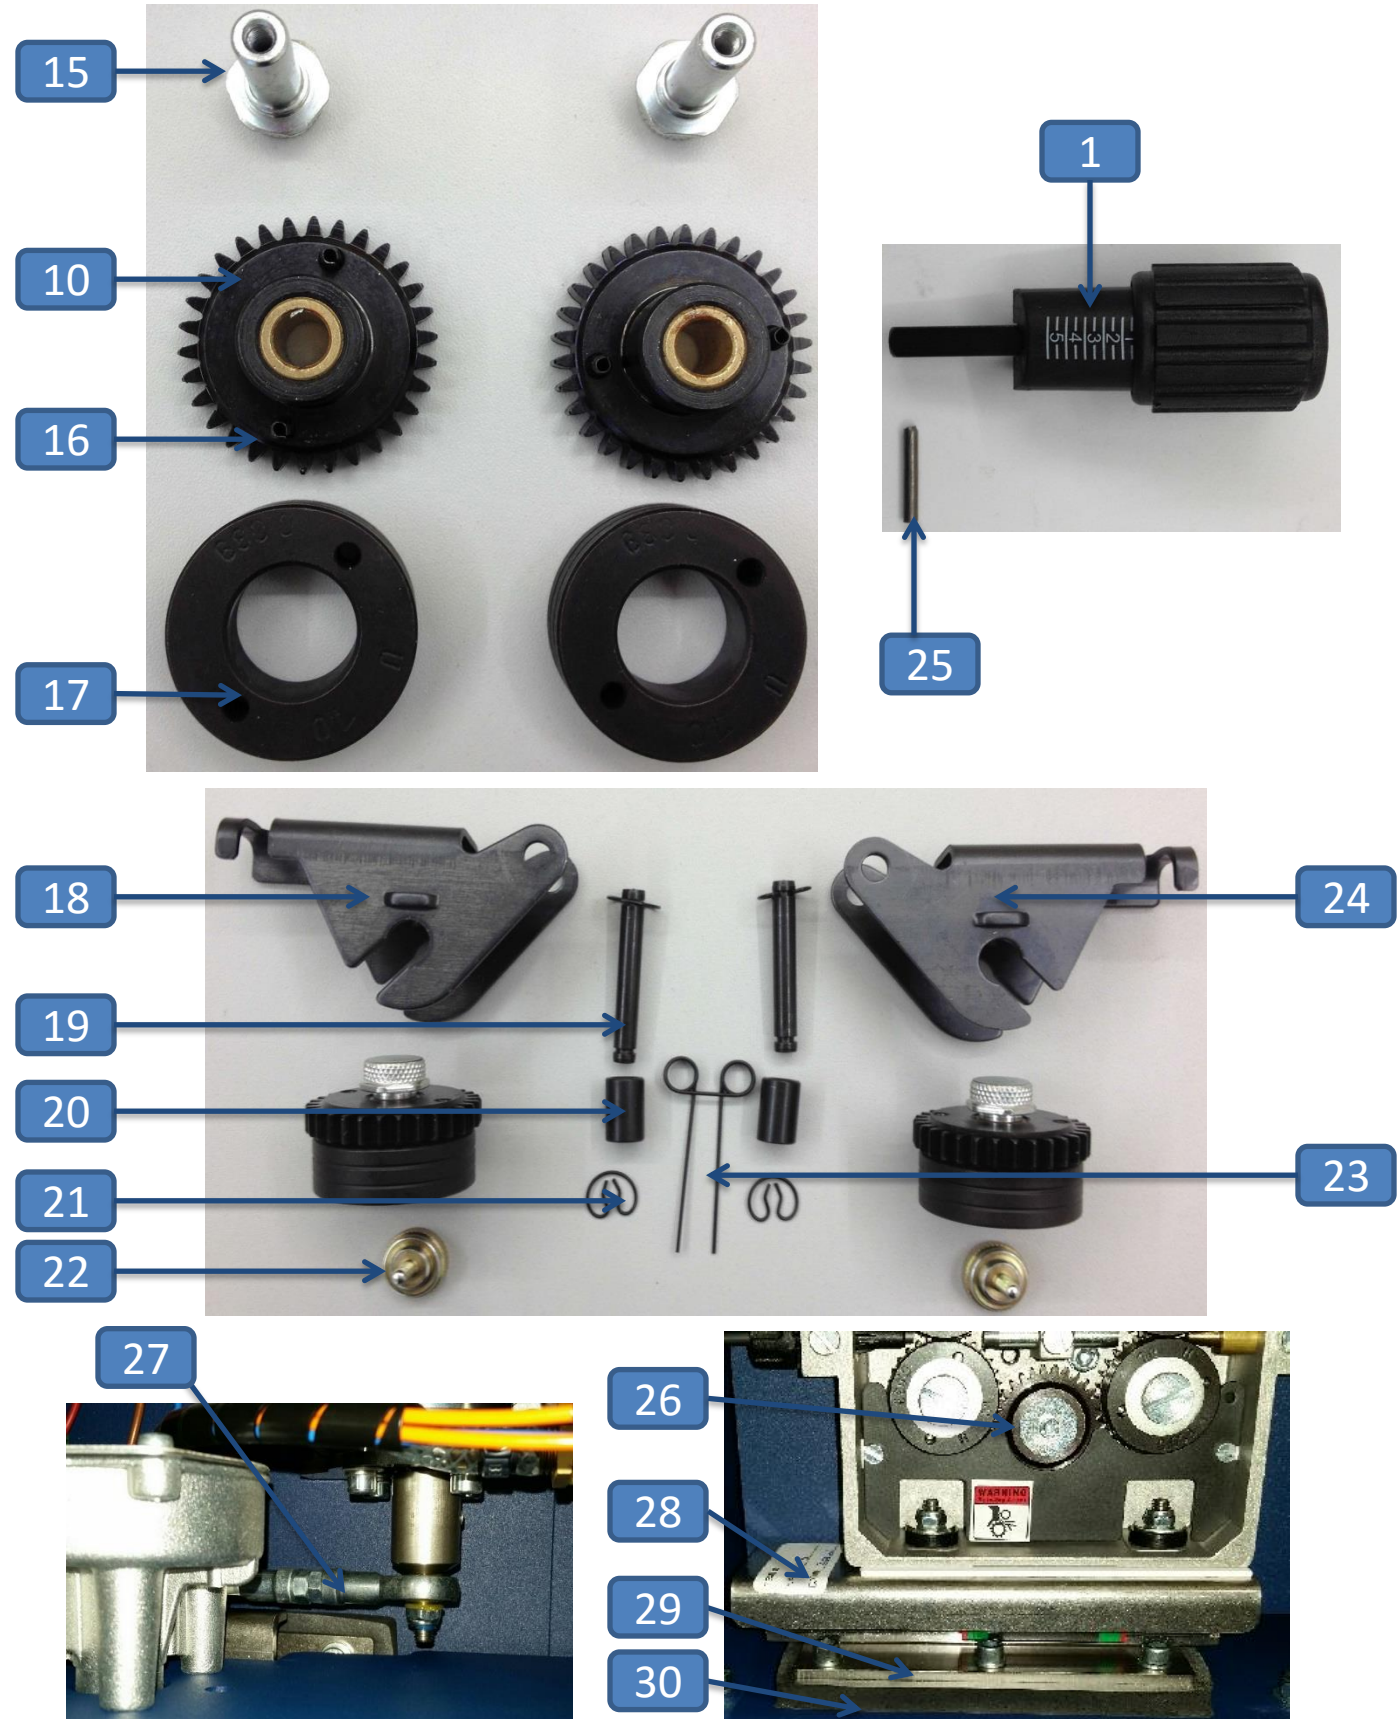

Pos. Description Part no.

1	TIPTIG Pressure device complete	88874002
2	TIPTIG Feed plate	88807002
3	TIPTIG Inlet guide with liner	88807024
4	TIPTIG Screw 5	88874021
5	TIPTIG Axle shaft gear adaptor -feed roll	88874015
6	TIPTIG Intermediate guide standard	88874013
7	TIPTIG Screw 6	88874022
8	TIP TIG Outlet Brass Guide	777005691
9	TIPTIG Screw 5	88874021
10	TIPTIG Gear adaptor feed	88874029
11	TIPTIG Washer 2	88874036
12	TIPTIG Knurled screw rolls	88874018
13	TIPTIG Screw 7	88874034
14	TIPTIG Guard safety kit	88874004
15	TIPTIG Axle pressure roll	88874014
16	TIPTIG Pin gear adaptor feed	88874027
17	TIPTIG U-Drive roll Ø 0.8-1.0mm	88807058
17	TIPTIG U-Drive roll Ø 1.0-1.2mm	88807060
17	TIPTIG U-Drive roll Ø 1.2-1.6mm	88807062
17	TIPTIG U-Drive roll Ø 0.9-0.9mm	88807064
18	TIPTIG Pressure arm left	88807011
24	TIPTIG Pressure arm right	88807012
19	TIPTIG Pressure device axis	88807007
20	TIPTIG Axle pressure roll	88807014
21	TIPTIG Circlip	88807016
22	TIPTIG Knurled screw pressure arm	88874017
23	TIPTIG Spring pressure arm auto lift	88874012
25	TIPTIG Pin	88807025
26	TIPTIG Main Drive Gear	88874030
27	TIPTIG Ball Bearing/ Rod End Connection	88800460
28	TIPTIG Linear Guide Rail / Heavy Duty Slide	88800697
29	TIPTIG Stainless Plate For Linear Rail	88800705
30	TIPTIG Rubber Plate	88800706
31	TIPTIG Teflon Outlet Tube	777005692
32	TIPTIG Stainless Triangle Bracket	77700163

WARRANTY INFORMATION

TIP TIG FEEDERS, TIPTIG HOTWIRE MODULES, TIP TIG POWERSUPPLYS

All TIP TIG systems have been calibrated from the manufacturer and are in compliance .

Within the warranty period of 12 Months from the date of purchase, TIP TIG USA will replace any warranted parts or components that fail due to such defects in material or workmanship. TIP TIG USA must be notified in writing within thirty (30) days of such defect or failure, at which time TIP TIG USA will provide information on the warranty claim procedures to be followed.

TIP TIG USA shall honor warranty claims on warranted equipment listed below in the event of such a failure within the warranty time periods. All warranty time periods start on the delivery date of the equipment to the original end-user purchaser, and not to exceed one year after the equipment is shipped to a North American location.

TIP TIG USA shall not bear the costs of transportation.

12 Month Parts and Labor

- Transformer
- Hotwire Unit
- PC Board
- Feed and Oscillator Motor
- Water Fitting and Bulkhead Connection
- Linear Motion Slide and Extenders
- Torches (Upon Initial Delivery Only)

What is Not Covered Under the Warranty

Consumable components; such as contact tips, nozzles, insulators, rings, collets gas lenses, back caps, liners, tungsten, universal tip guides or any torch accessory Is not covered under the manufactures warranty.

Causes for Warranty to be Voided

Damage, fault or failure due to alteration or repairs made by anyone other than Tip Tig USA shall void the warranty

For TIPTIG Service please call:
856-312-8166



TIP TIG USA 155 E 9th Ave Suite A Runnemede, NJ 08078

TIP TIG Extreme HW Torch SC18 4.0M


10002461

TIP TIG 18SC Torch Body Replacement

99903360

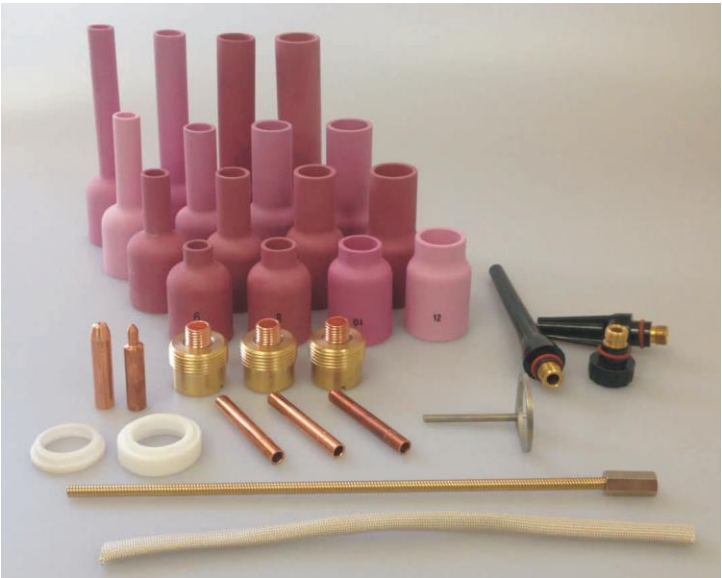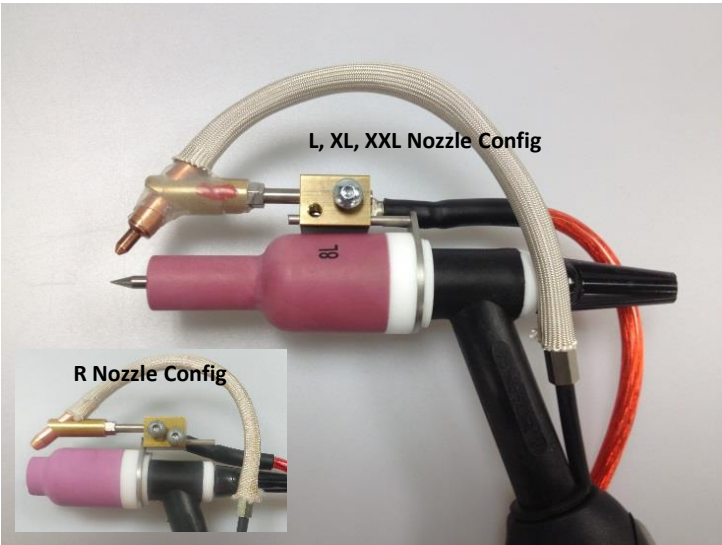

HD Insulator

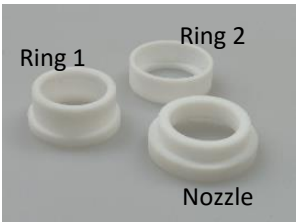

Gas Lens

3/32"	99900524
1/8"	99900526
5/32"	99900528

Collets

3/32"	99901031
1/8"	99901032
5/32"	99901033

Ring

Outside F	77700630
Inside B	77700631

Standard Insulator

Ring	77700214
Nozzle	77700605

HD Insulator

Ring 1	77700208
Ring 2	77700209
Nozzle	77700210

Nozzles

#6 3/8"	77700530	#6XL 3/8"	77700575
#8 1/2"	77700532	#8XL 1/2"	77700576
#10 5/8"	77700533	#10XL 5/8"	77700577
#12 3/4"	77700534	#12XL 3/4"	77700578
#6L 3/8"	77700570	#6XXL 3/8"	77700585
#8L 1/2"	77700571	#8XXL 1/2"	77700586
#10L 5/8"	77700572	#10XXL 5/8"	77700587
#12L 3/4"	77700573	#12XXL 3/4"	77700588

Back Caps

Small	77700240
Med	77700241
Large	77700242

Tip Holder

39 Deg Fillet	77700686
42 Deg Butt	77700685

Liner

Bronze Liner	77700566-A
--------------	------------

Insulator

Fiber Sleeve	77700548-A
--------------	------------

Tips Regular

Cooper .035"	77700536
Cooper .045"	77700537
Cooper .068"	77700538

Narrow Groove Tips



.035"	77700536B
.045"	77700537B

TIP TIG Extreme HW Torch SC18 4.0M

10002461

TIP TIG 18SC Torch Body Replacement

99903360

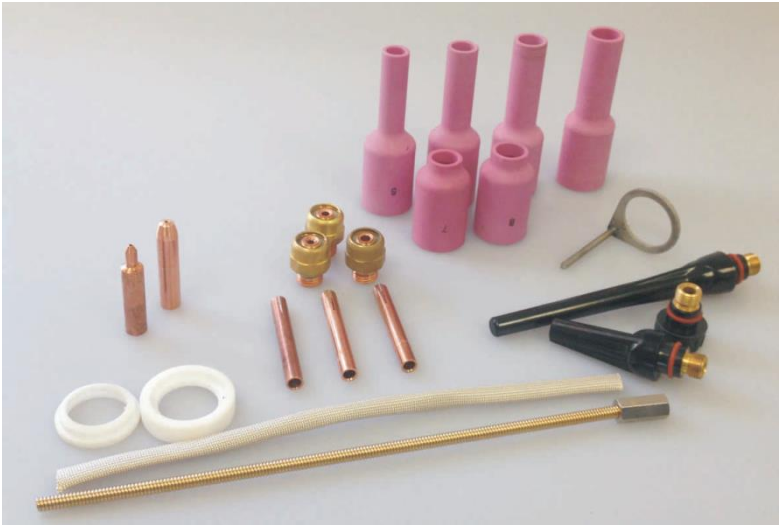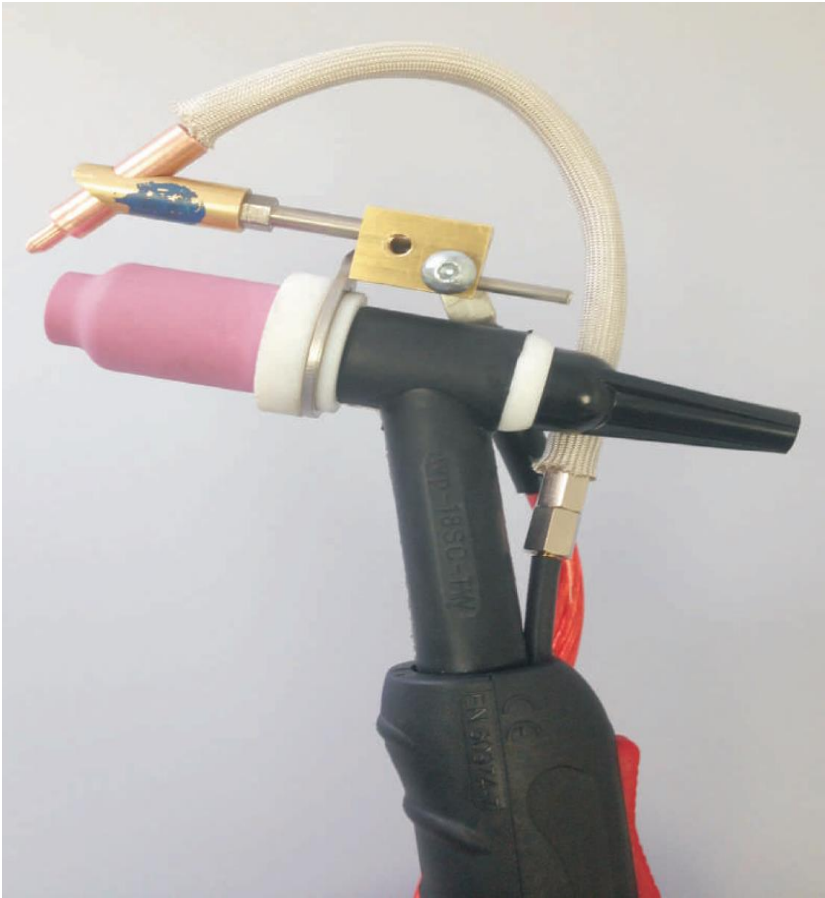

Gas Lens

3/32"	99900024
1/8"	99900026
5/32"	99900028

Collets

3/32"	99901031
1/8"	99901032
5/32"	99901033

Ring

77700631

Ring Insulator

77700214

Nozzle Insulator

77700252

Nozzles

#5 5/16"	99902050
#6 3/8"	99902052
#7 7/16"	99902054
#8 1/2"	99902056
#5L 5/16"	99902060
#6L 3/8"	99902062
#7L 7/16"	99902064
#8L 1/2"	99902066

Back Caps

Small	77700240
Med	77700241
Large	77700242

Tip Holder

39 Deg Fillet	77700686
42 Deg Butt	77700685

Liner

Bronze Liner	77700566-A
--------------	------------

Insulator

Fiber Sleeve	77700548-A
--------------	------------

Tips Regular

Cooper .035"	77700536
Cooper .045"	77700537
Cooper .068"	77700538

Narrow Groove Tips


.035"	77700536B
.045"	77700537B

TIP TIG Extreme HW Torch SC20 FLEX

10002480

TIP TIG SC20 FLEX BODY REPLACEMENT

77700236

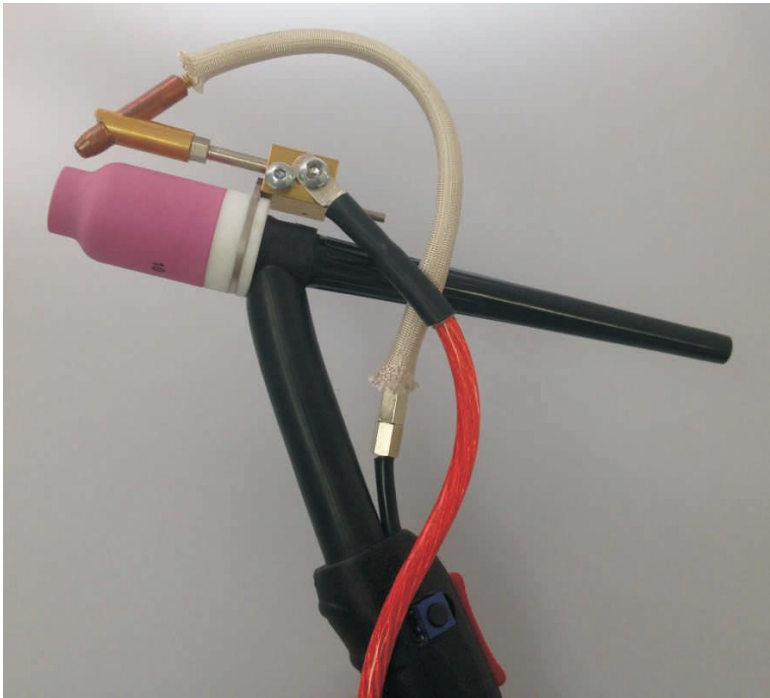

Gas Lens

1/16"	99900110
3/32"	99900112
1/8"	99900114

Collets

1/16"	77700455
3/32"	77700456
1/8"	77700457

Ring

77700630

Ring Insulator

77700370

Nozzle Insulator

77700607

Nozzles

#6 3/8"	77700530
#8 1/2"	77700532
#10 5/8"	77700533
#12 3/4"	77700534

Back Caps

Small	99903008
Med	99903009
Large	99903010

Tip Holder

39 Deg Fillet	77700686
42 Deg Butt	77700685

Liner

Bronze Liner	77700566-A
--------------	------------

Insulator

Fiber Sleeve	77700548-A
--------------	------------

Tips Regular


Cooper .035"	77700536
Cooper .045"	77700537
Cooper .068"	77700538

Narrow Groove Tips

.035"	77700536B
.045"	77700537B


TIP TIG Extreme HW Torch SC20 FLEX
UP/DOWN Wire Feed Button
10002480

TIP TIG SC20 FLEX BODY REPLACEMENT
77700236

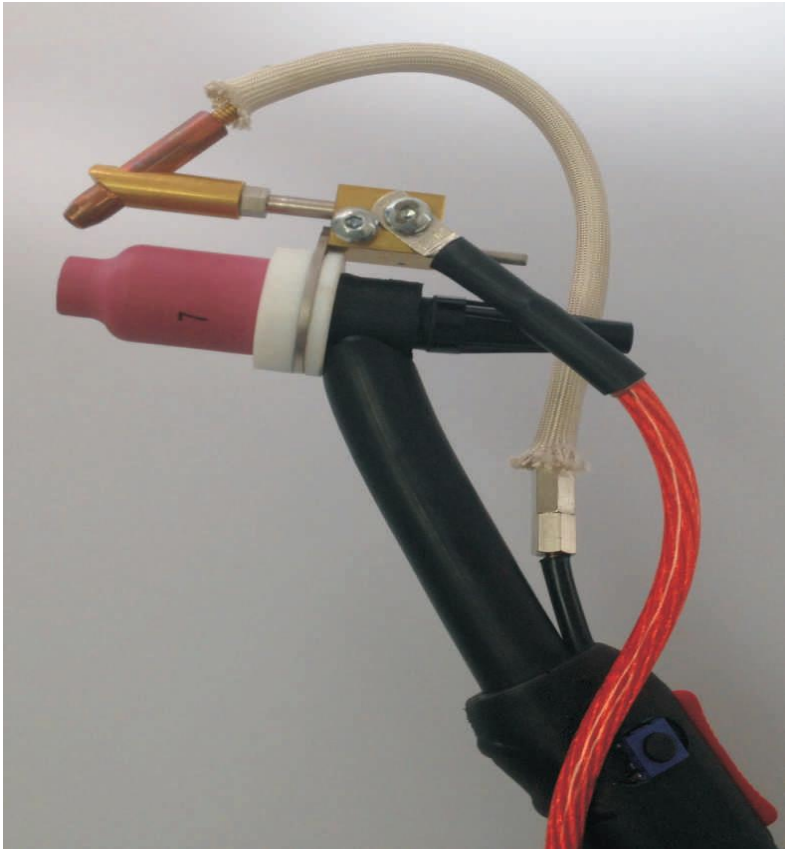


Gas Lens	
1/16"	99900100
3/32"	99900102
1/8"	99900104
Collets	
1/16"	77700455
3/32"	77700456
1/8"	77700457
Ring	
	77700630
Ring Insulator	
	77700370
Nozzle Insulator	
	77700252
Nozzles	
#5 5/16"	99902050
#6 3/8"	99902052
#7 7/16"	99902054
#8 1/2"	99902056
#5L 5/16"	99902060
#6L 3/8"	99902062
#7L 7/16"	99902064
#8L 1/2"	99902066
Back Caps	
Small	99903008
Med	99903009
Large	99903010
Tip Holder	
39 Deg Fillet	77700686
42 Deg Butt	77700685
Liner	
Bronze Liner	77700566-A
Insulator	
Fiber Sleeve	77700548-A
Tips Regular	
Cooper .035"	77700536
Cooper .045"	77700537
Cooper .068"	77700538
Narrow Groove Tips	
.035"	77700536B
.045"	77700537B


Standard

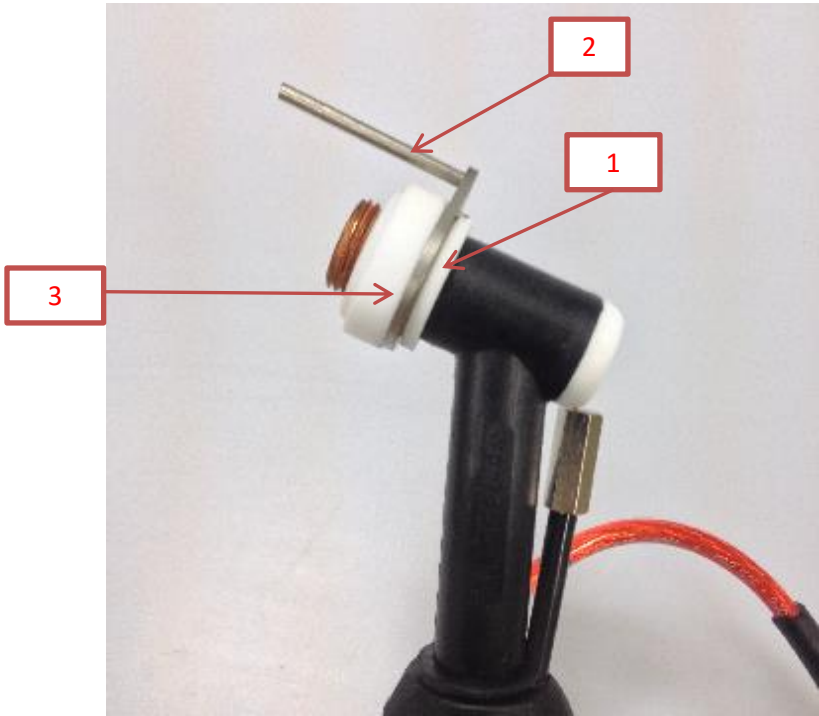

HD

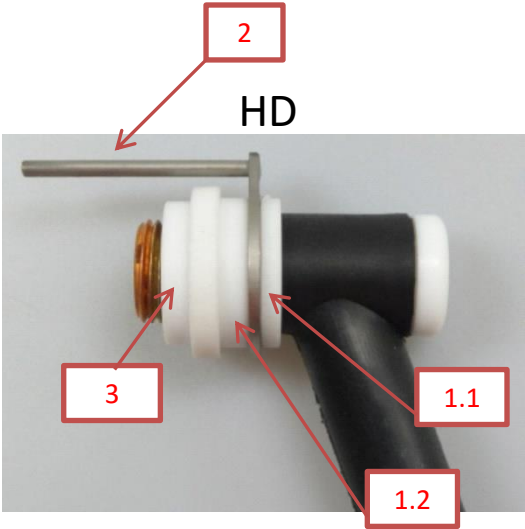


- Step 1- Install the Ring Insulator
- Step 2- Install the Ring for Universal Tip Holder
- Step 3- Install the Nozzle Insulator

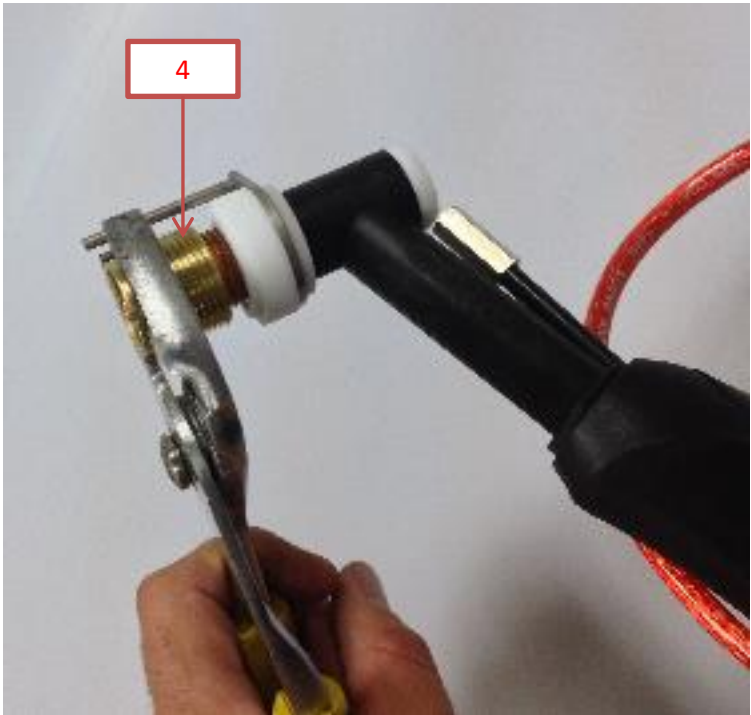

- Step 4- Install the Gas Lens by hand, then tighten slightly with pliers as shown.

SECTION IX

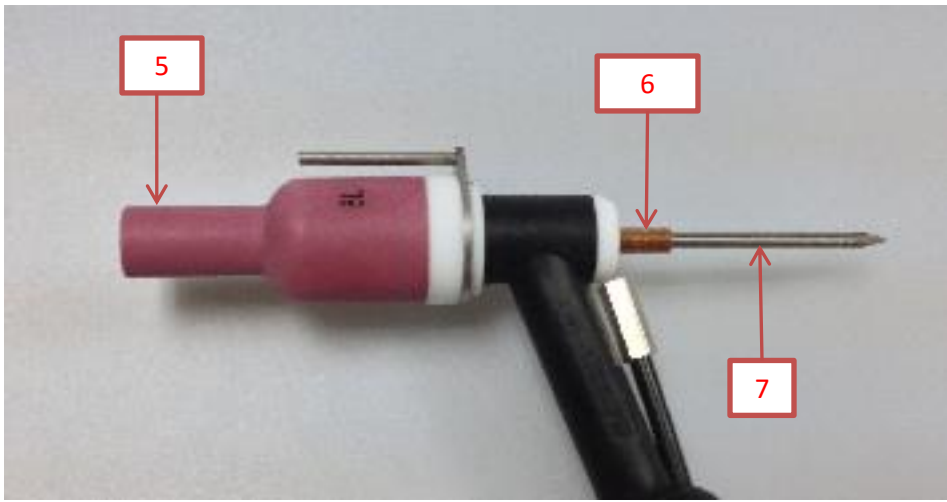


Step 5- Install the Gas Nozzle

Step 6- Install the Collet

Step 7- Install the Tungsten



Step 8- Install the Back Cap and tighten to secure the tungsten in place.

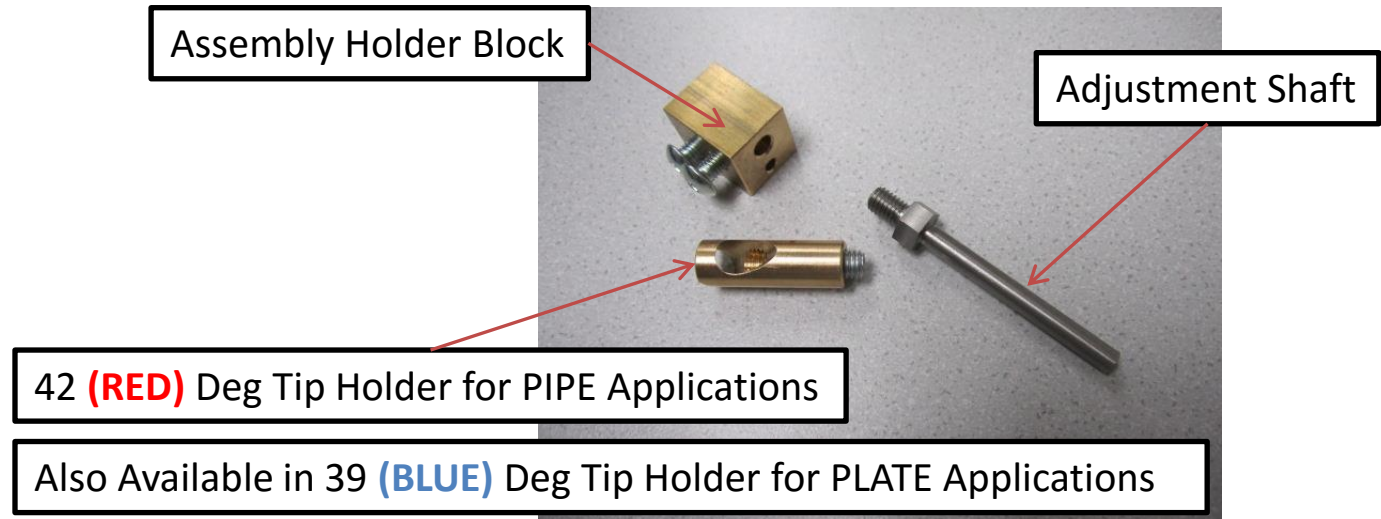


Tip / Liner Assembly



7.5" Liner Assembly will work on Regular and Large Nozzle Sizes




Loosen the Set Screw inside the Tip Holder

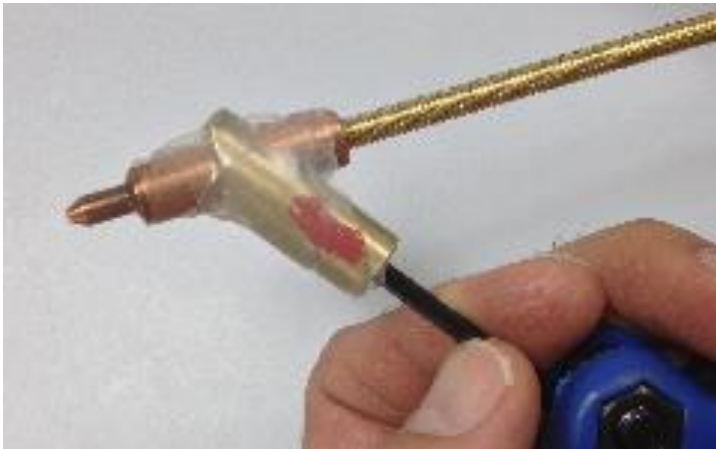


Install the weld repellant tape as shown.

Install the Tip Assembly into the Tip Holder and tighten.

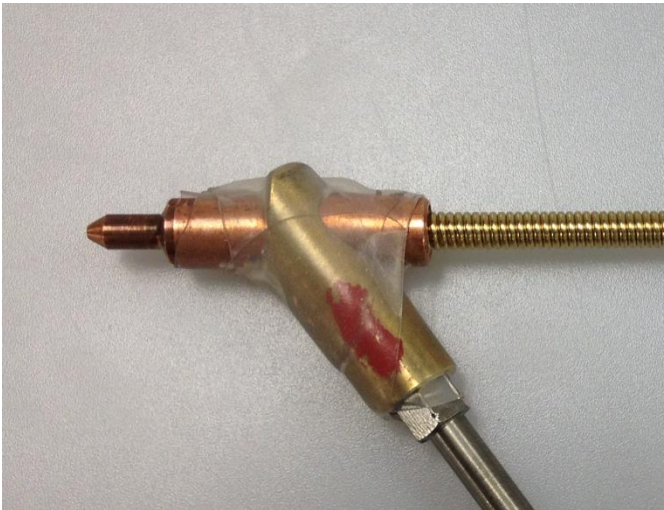


Install the Tip Assembly Shaft.

SECTION IX

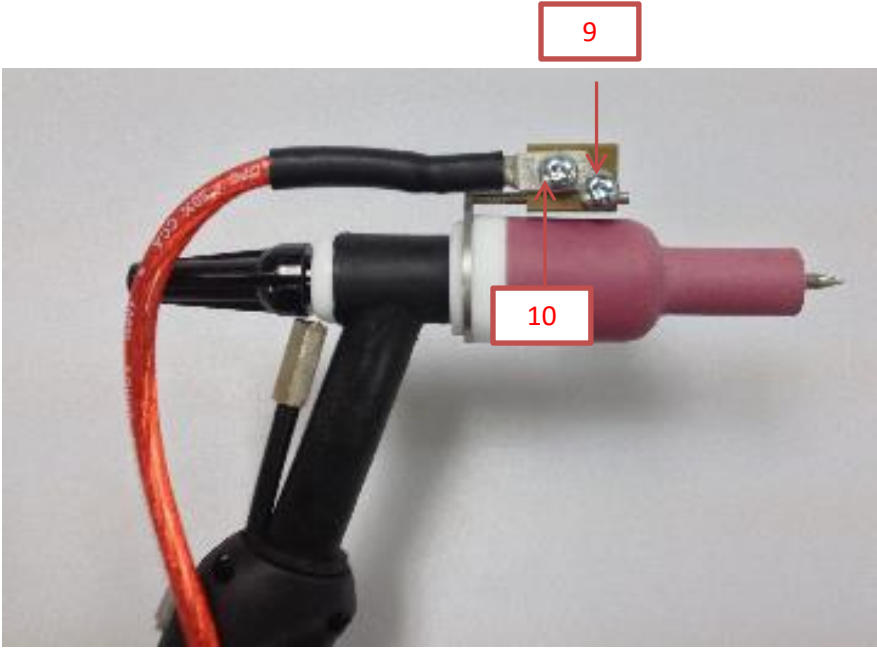


- Step 9- Install the Assembly Holder Block to the Ring and secure with screw.
- Step 10- Attach Hotwire Cable to Assembly Holder Block with screw..

Radius of Tip Assembly needs to have a uniformed radius as shown for best wire feeding results

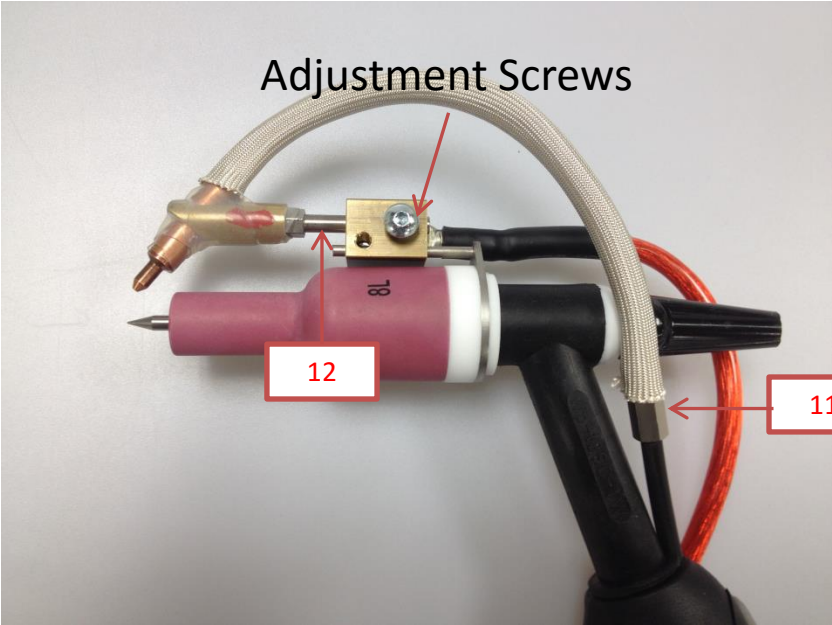

Push in liner and twist counter clockwise to seat in place.

- Step 11- Push in Liner Assembly to Hull Adapter on torch
- Step 12- Connect Adjustment Shaft to Assembly Holder Block and tighten screws

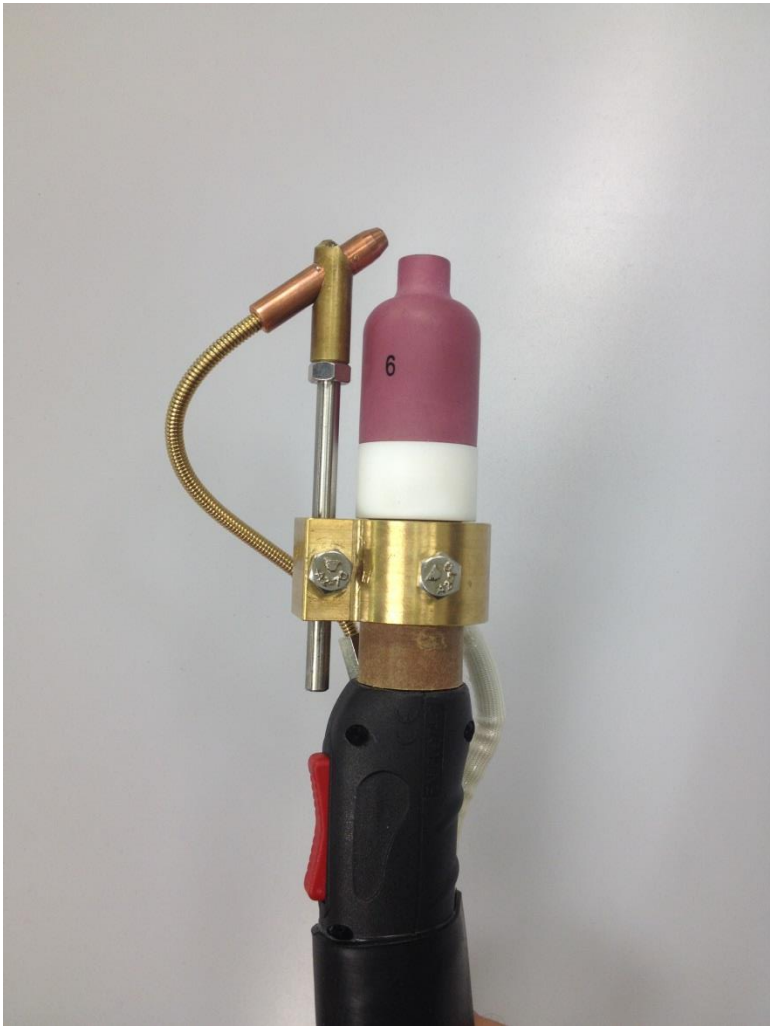

Tip Tig HW Torch 410 Straight

10004980

Gas Lens

3/32"	99900724
1/8"	99900726
5/32"	99900728

Collets

3/32"	77700441 / 77700432
1/8"	77700442 / 77700433
5/32"	77700443 / 77700434

Ring Insulator

77700845

410 180 Deg. Brass Block

10004912

Nozzles

#6 3/8"	77700530
#8 1/2"	77700532
#10 5/8"	77700533
#12 3/4"	77700534

Back Caps

TIP TIG AUT Torch Cap "A" Short
77700418

TIP TIG AUTO Electrode Case

77700420

Stainless Steel Shaft

60000173

Tip Holder

39 Deg	77700686
42 Deg	77700685

Liner

Bronze Liner 77700566

Insulator

Fiber Sleeve 77700548

Tips Regular

Cooper .035"	77700536
Cooper .045"	77700537
Cooper .068"	77700538

Narrow Groove Tips

.035"	77700536B
.045"	77700537B

TIP TIG HW AUTO TORCH 410

10000700 (A) 14, 10000705 (A) 21
10000710 (B) 14, 10000715 (B) 21

Torch A = 8" Barrel Height
Torch B = 14" Barrel Height



Gas Lens
5/32" 99900728

Collets
5/32' 77700443

Ring Insulator
77700845

Nozzles
#6 3/8" 77700530
#8 1/2" 77700532
#10 5/8" 77700533
#12 3/4" 77700534

Back Caps
TIP TIG AUTO Torch Cap "A" 77700415
TIP TIG AUTO Torch Cap "B" 77700416

TIP TIG AUTO Electrode Case 77700420
AUT 410 S Collet 4.0mm 77700434

TIP HOLDER AUTOMATION
TIPTIG Aut torch nozzle adjustment X-Y-Z slides.
10003465

Liner
Bronze Liner 77700566

Insulator
Fiber Sleeve 77700548

Tips Regular
Cooper .035" 77700536
Cooper .045" 77700537
Cooper .068" 77700538

Narrow Groove Tips
.035" 77700536B
.045" 77700537B

39 DEG TIP HOLDER AUTO 77700716

1

Identify the Tungsten Collet (left) and the Electrode Case (Right).



4

Insert the Tungsten into the Electrode Case, adjust stick out and tighten Electrode Case.



2

Insert the two parts together




3

Insert the Inner Collet as per Tungsten Size into the electrode case.

NOTE: Inner Collets NOT USED on Handheld torch




TIPTIG FEEDER HAND VERSION 1.6 CIRCUIT DIAGRAM


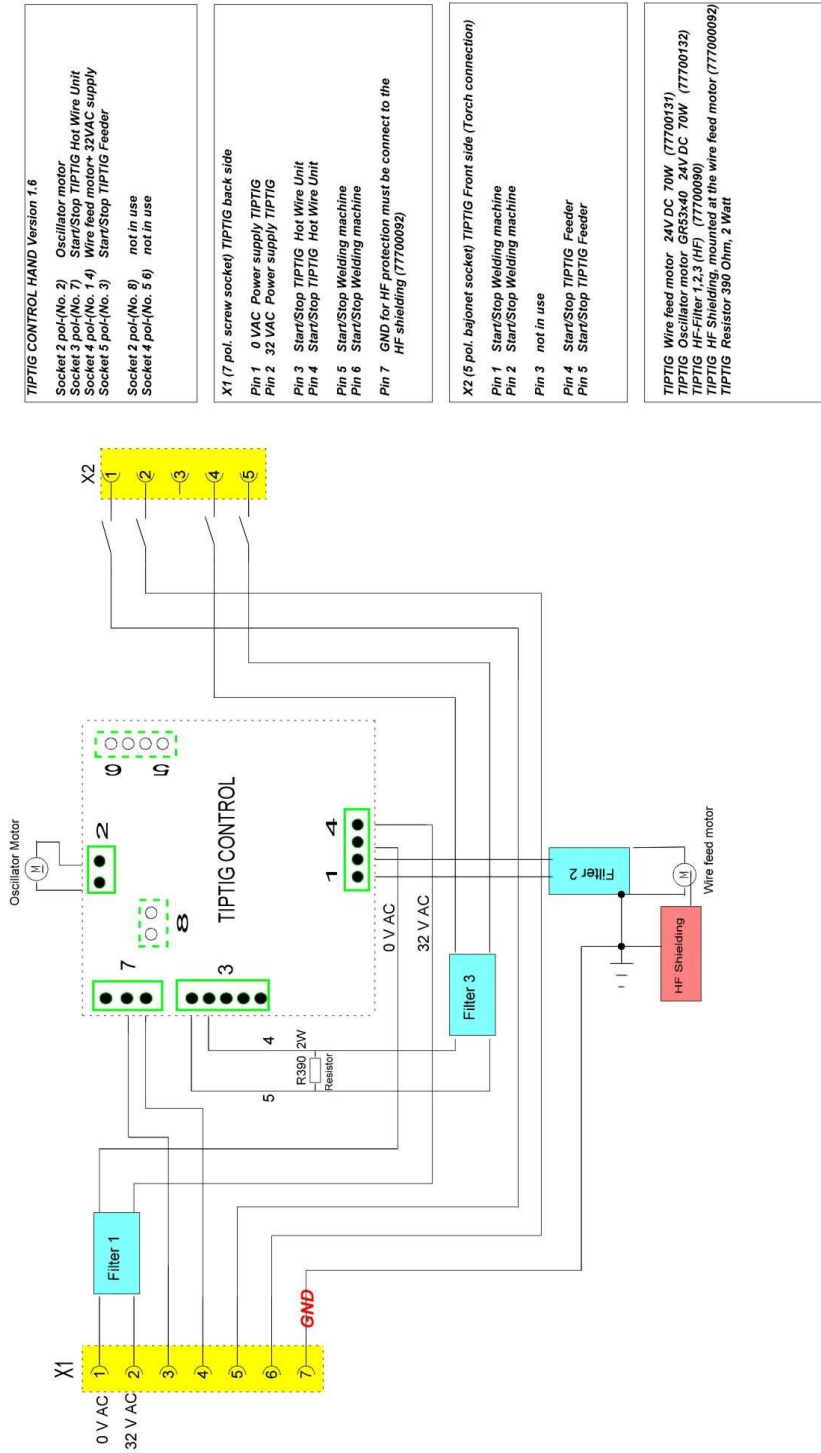


Ing.Siegfried Plasch, Austria
01.03.2010

TIPTIG HOT WIRE MODUL CIRCUIT DIAGRAMM

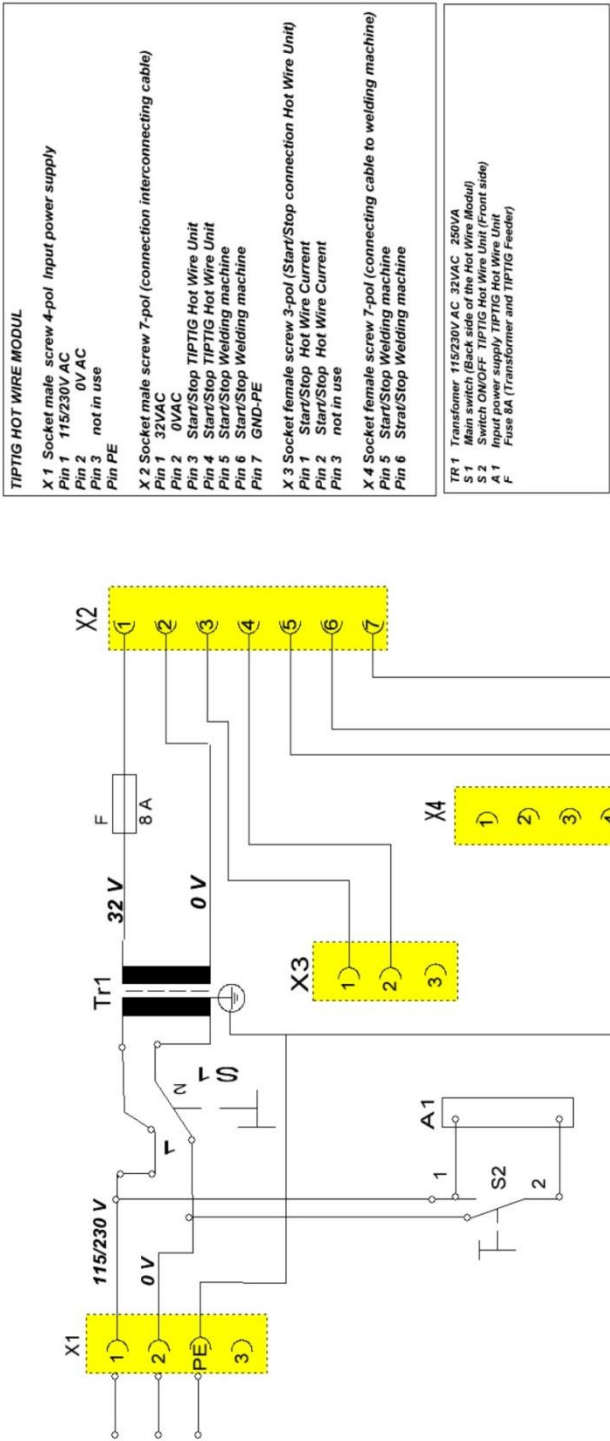




Ing. Siegfried Plasch, Austria
01.03.2010

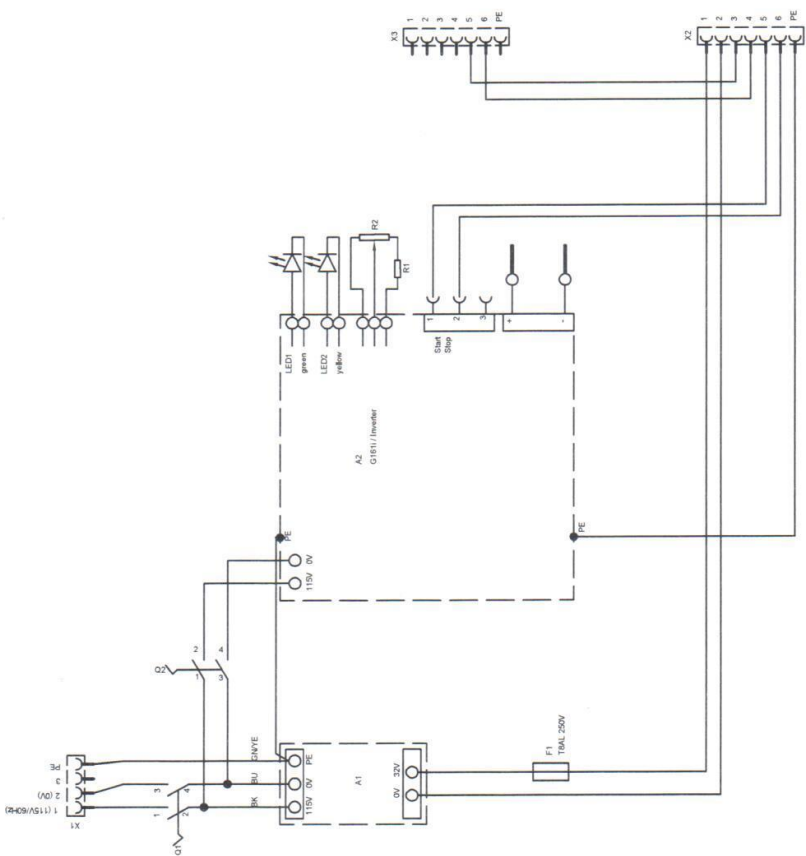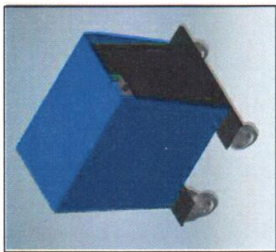


- A1 Isolating transformer
- A2 G1611 / Inverter
- Q1 Main switch
- Q2 Switch for inverter
- F1 Fuse
- R1 Resistor 7.5 kOhm
- R2 Potentiometer
- X1 4 Pin socket (male)
- X2 7 Pin socket (male) -> to TIP TIG
- X3 7 Pin socket -> to power source (Miller)

TIP TIG	Circuit diagram 1313 HW-Module 2014 (TIP TIG - USA)		
	Name: Jurgan Planch		
	Date: 08/2015		
	No: 1313.001		
	120V / 60Hz		

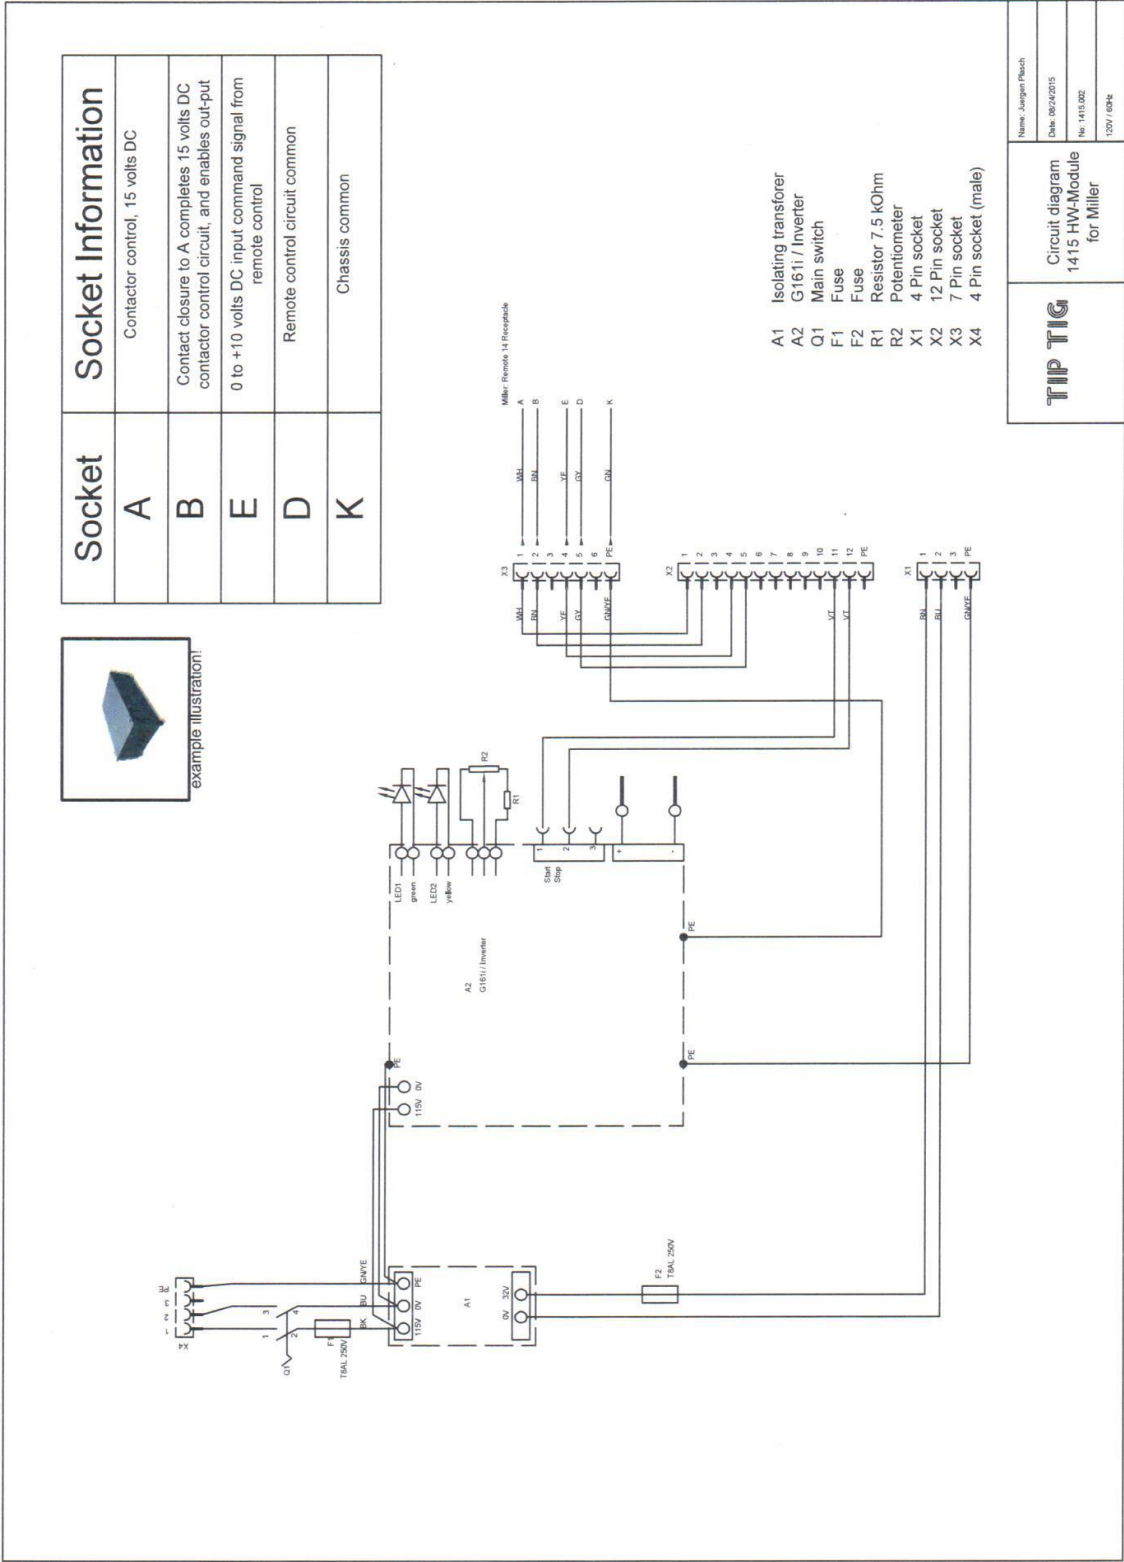

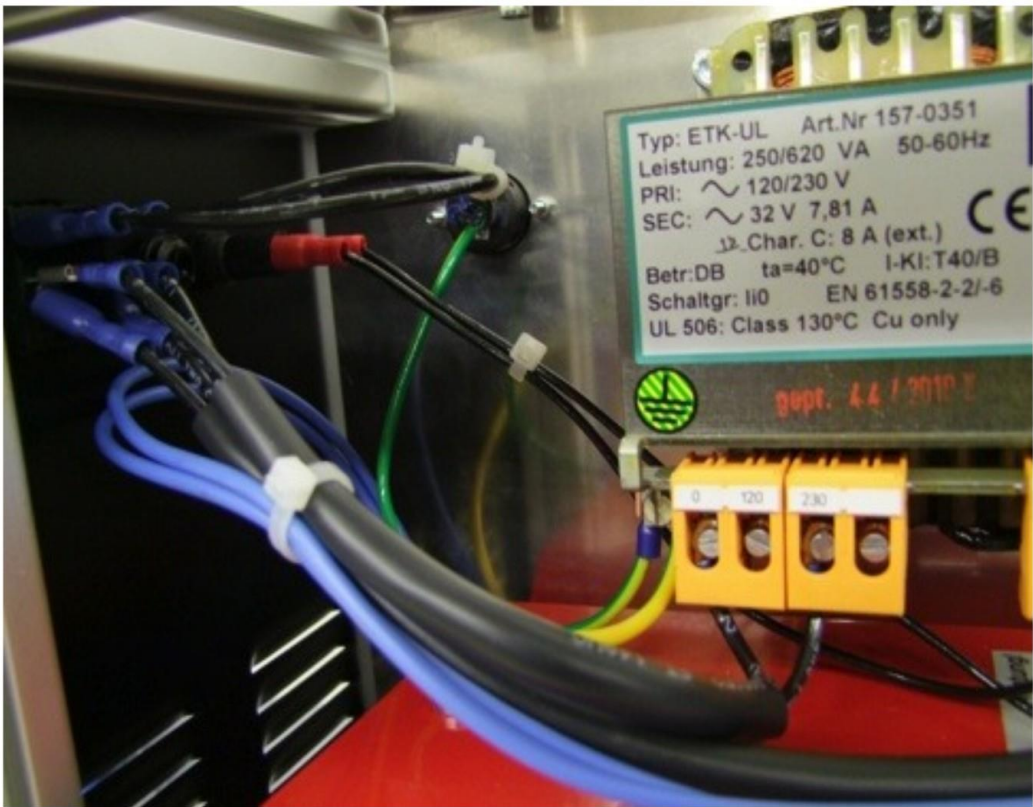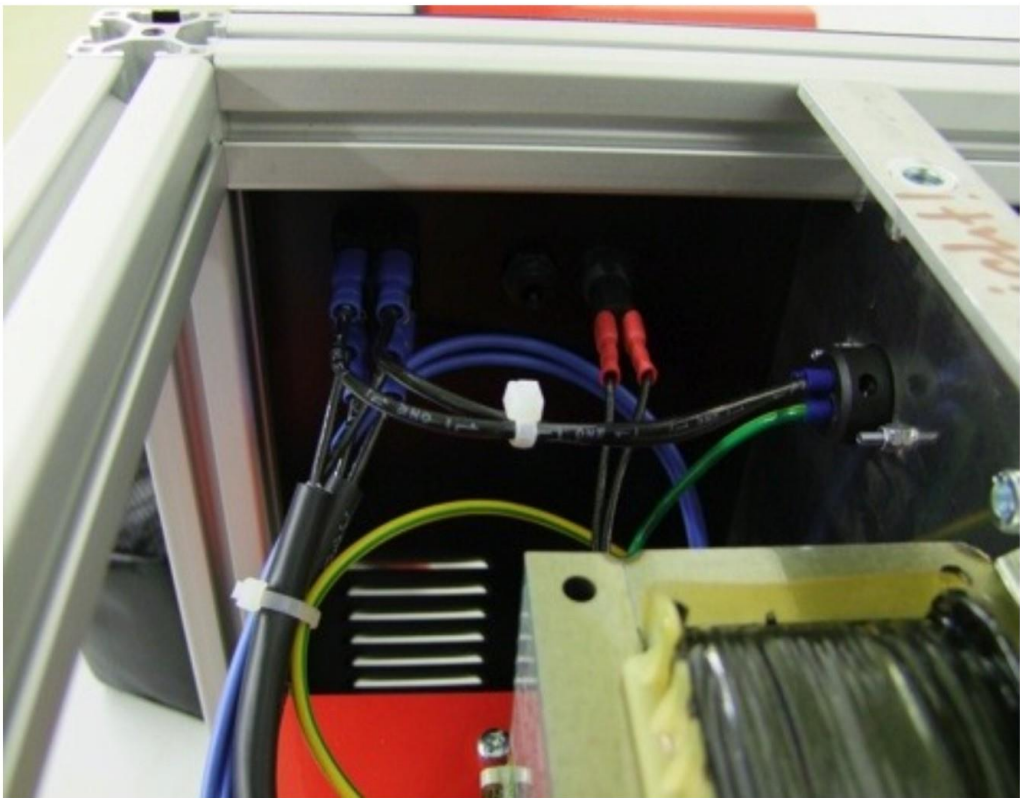



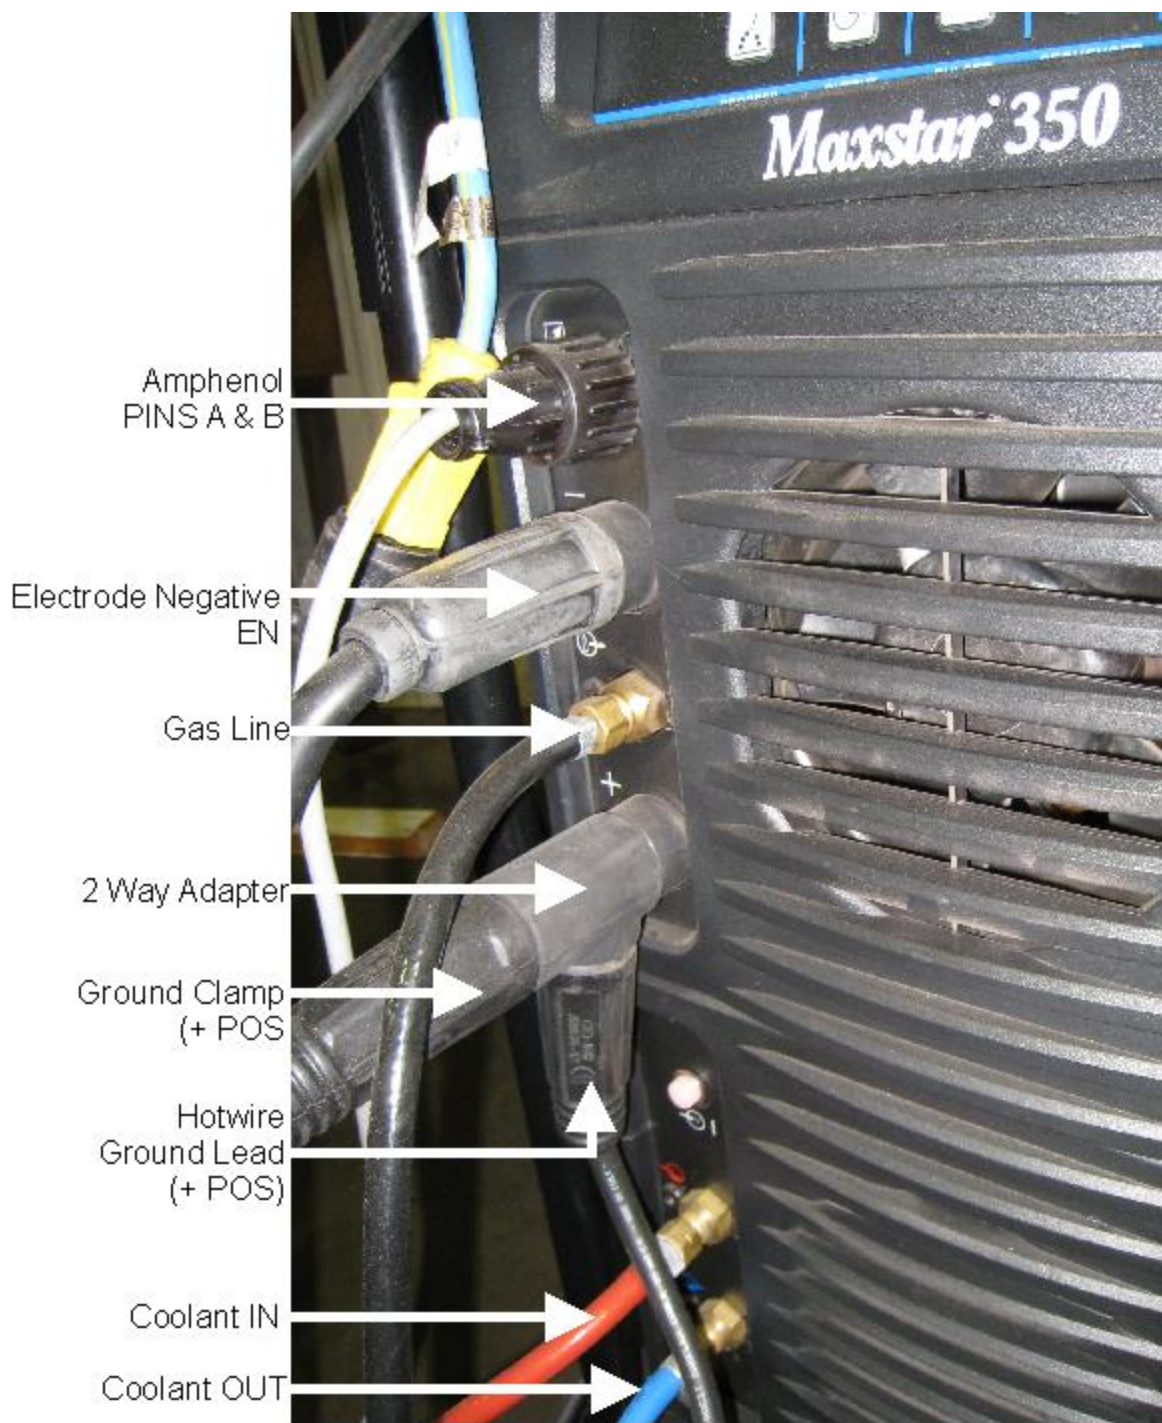

MILLER MAXSTAR CONNECTION GUIDE

**NOTE: DO NOT PLUG THE TIP TIG ONTO BACK OF POWERSUPPLY
USE SEPARATE 115V RECEPTACLE**

MILLER MAXSTAR 350 / DYNASTY 350
BASIC SETTINGS

POLARITY **(DC)** - Steel Alloys, Stainless Steel, Nickel, Copper, Titanium
 (AC) - Aluminum, Magnesium

PROCESS - TIG HF IMPULSE is the standard selection for High Frequency Starts

OUTPUT - RMT 2T HOLD – is used in replace of a foot pedal to engage and hold the arc while welding.

AMP - Main Amperage Set

INERT GAS USED - 100% Argon used with a regular at 30-40 CF for most welding.

ADVANCED SETTINGS

PULSER – Not Recommended.

SEQUENCER - The TIP TIG Process does not require a foot pedal. The Sequencer settings is where you can control your start and stop settings in replace of the foot pedal.


- INITIAL AMPERAGE (AMP VALUE)
- INITIAL SLOPE TIME (TIME VALUE)
- FINAL SLOPE TIME (TIME VALUE)
- FINAL AMPERAGE (AMP VALUE)

GAS/DIG - PreFlow and PostFlow provide shielding before and after the starts and stops and are set in seconds.

DO NOT PLUG THE TIP TIG INTO THE BACK OF YOUR POWERSUPPLY
AS THE HF INTERFERS WITH THE TIP TIG EQUIPMENT.
USE A SEPARATE 115V OUTLET.



TIP TIG WELD DATA CHART

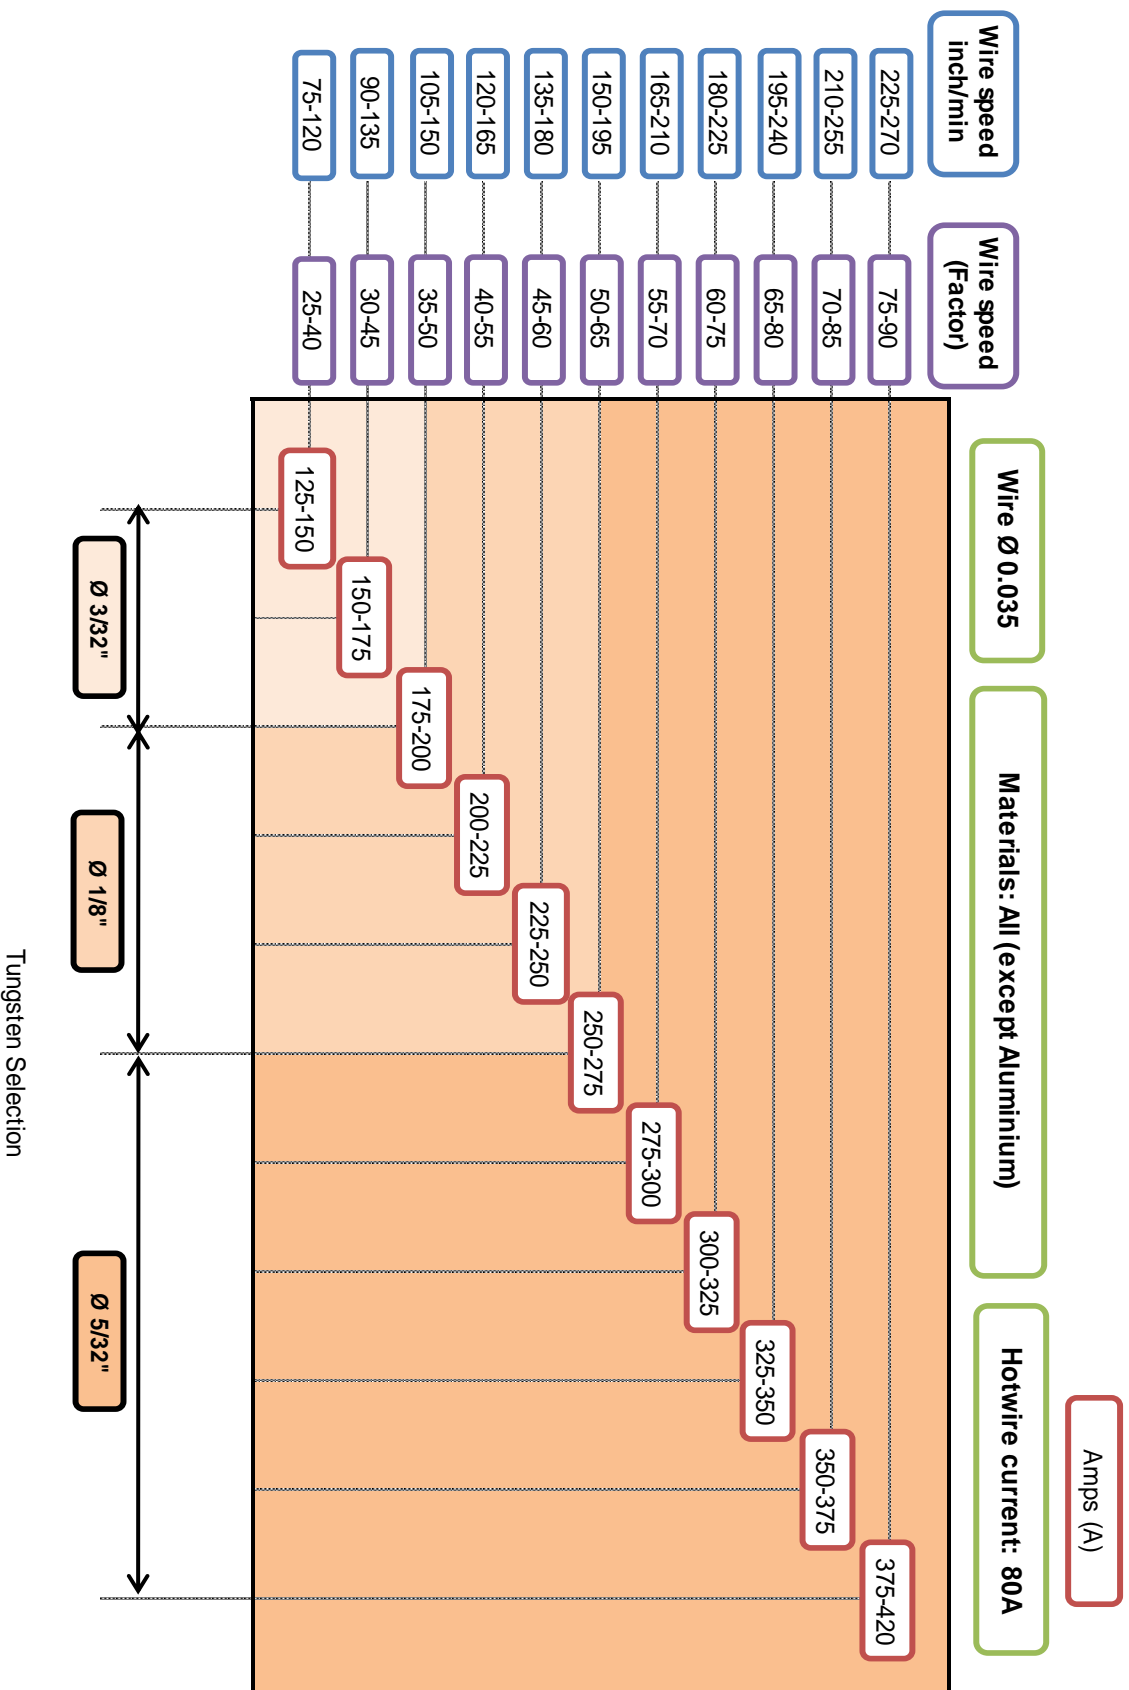


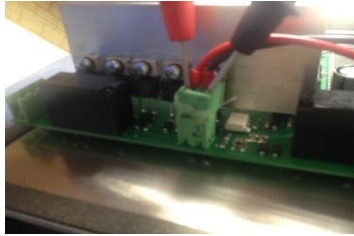


TIPTIG Hand Hotwire Welding Wire Ø 0.035 and Ø0.045in!

Baseline Start Up Parameters!

Please test all parameters before start of any work!

Troubleshooting Guide

Trouble	Remedy
PC Board will not power / LED Display Blank	<p>Check 120V AC Input Power Supply from power cord plug end.</p> <p>Check fuse on rear panel</p> <p>Check 120V AC at transformer with meter</p> <p>Check 32V AC at transformer with meter</p> <p>Remove front panel PC board. Test PLUG 14 (BR/BL) for 32V AC</p> <div data-bbox="1025 262 1375 498" data-label="Image"> </div> <div data-bbox="1025 521 1375 757" data-label="Image"> </div> <div data-bbox="1025 838 1375 1074" data-label="Image"> </div>
If all of the above checks show voltage, PC Board is faulty and needs to be replaced.	
Feeder Motor will not operate when button pressed on torch.	<p>Check to make sure PC Board has voltage.</p> <p>Check fuse on rear panel.</p> <p>Continue the test using a torch that is properly working.</p> <p>Check PLUG 14 (BK/RD) for 5 - 32V DC</p> <p>Press Wirefeed button on torch.</p> <p>If voltage is present, continue to next step</p> <p>If voltage isn't present, check torch button</p> <p>Check HF Filter input for 5 - 32V DC</p> <p>Press Wirefeed button on torch.</p> <p>If voltage is present, continue to next step</p> <p>If voltage isn't present, check torch button</p> <div data-bbox="1025 1292 1375 1528" data-label="Image"> </div> <div data-bbox="1025 1551 1375 1787" data-label="Image"> </div>

Trouble	Remedy
	<p>Cont.</p> <p>Check HF Filter onput for 5 - 32V DC</p> <p>Press Wirefeed button on torch.</p> <p>If voltage is present, continue to next step</p> <p>If voltage isn't present, filter is faulty</p> 
If all of the above checks show voltage, Wirefeed Motor is faulty and needs to be replaced.	
Oscillator Motor will not operate when button pressed on	<p>Check to make sure PC Board has voltage.</p> <p>Check fuse on rear panel.</p> <p>Continue the test using a torch that is properly working.</p> <p>Check PLUG 2 (BK/RD) for 24V DC</p> <p>Press Wirefeed button on torch.</p> <p>If voltage is present, oscillator motor faulty</p> <p>If there is still no voltage, bad PC board.</p> 
If all of the above checks show voltage, Wirefeed Motor is faulty and needs to be replaced.	
No Hotwire Input Power	<p>Check to make sure On/ Off switch on front panel is on.</p> <p>Check to make sure GREEN LED is on.</p> <p>Check 120V AC at transformer with meter</p> <p>Check the wire termination behind the front on/off switch for 120V AC power.</p> <p>Check the lower 2 wires first which confirms 120V AC power from transformer.</p> <p>Check the upper 2 wires second which confirms 120V AC power flowing thru the on/off switch.</p> <p>If voltage isn't present, switch is faulty</p>  
If all of the above checks show voltage, Hotwire is faulty and needs to be replaced.	

Trouble	Remedy
<p data-bbox="25 50 272 112">No Hotwire Output Amperage / Voltage</p>	<p data-bbox="329 50 1353 185">Check to make sure On/ Off switch on front panel is on. Check to make sure GREEN LED is on. Connect probe from the female hotwire dinse connection on the interconnect cable to the female dinse panel mount as shown below</p> <div data-bbox="335 222 684 459" data-label="Image"> </div> <div data-bbox="755 222 1103 459" data-label="Image"> </div> <p data-bbox="329 513 1282 575">With the 5 pin connector from the torch plugged into the wirefeed connection press the wire feed button, the output voltage will be 12V</p> <p data-bbox="329 620 1149 720">Next you will see that we made a cable for testing output. This cable has a small and large dinse male connector. Connect to the same locations shown above with this special cable.</p> <div data-bbox="335 753 684 991" data-label="Image"> </div> <p data-bbox="329 1045 1282 1145">Clamp your meter around the cable With the 5 pin connector from the torch plugged into the wirefeed connection press the wire feed button, and set the POT to 80 amps</p> <div data-bbox="325 1182 672 1420" data-label="Image"> </div> <p data-bbox="329 1474 1225 1535">You should see your AMP setting on your meter Adjust you POT to ensure proper function and that the amperage changes</p> <p data-bbox="329 1580 782 1611">If no adjustment is seen, replace POT</p> <p data-bbox="329 1655 1129 1717">Check to make sure all dinse connections are properly installed Check to make sure Hotwire ground is connected to power supply</p> <p data-bbox="168 1725 1258 1756">If all of the above checks show no amperage, Hotwire is faulty and needs to be replaced.</p>

Trouble	Remedy
Wire Feeding Issues	<p>Worn drive rolls or pressure device not set properly. Replace or adjust as needed</p> <p>Drive rolls not matched properly to wire size. Correct drive rolls</p> <p>Wire not riding true inside drive rolls. Adjust</p> <p>Incorrect radius for bronze liner on gun. Liner should be 7.5" from the handle with the hull device shown just below the WP18 torch body.</p> <p>Wire to tip size not matched properly. Try the next larger tip size.</p> <p>Worn or defective bronze liner. Replace</p> <p>Liner in torch defective. Replace</p> <p>Tension on pressure device not set correctly. Adjust pressure to correct wire slippage</p> <p>Wire Spool too tight. Adjust pressure at hub to correct drag of wire.</p> <p>Make sure outlet tube and brass guide are concentric in feeder assembly.</p>
No Hi Frequency	<p>Power supply not set to TIG HF.</p> <p>Bad torch ground. Check to make sure there isn't a short on the gun side where the torch body is not properly shielded.</p> <p>Bad ground inside TIP TIG feeder. Check that ground lugs do not have interference with chassis. Correct as needed.</p>
Tungsten burnback	<p>Wrong polarity set. Correct</p> <p>Positive to ground and hotwire. Negative to TIG cable.</p>

Preventative Maintenance	
Daily	
Drive Roll Alignment	<p>Check for excessive wear and wire alignment inside the groove.</p> <p>Re-align upper drive rolls or replace drive rolls to the appropriate wire size.</p>
Inlet and Outlet Guides	<p>Check for excessive wear and wire alignment inside the groove.</p> <p>Outlet guide should move freely between the brass guide and the torch connection.</p> <p>Adjust or replace as needed.</p>
Wire Pressure Device	<p>Drive rolls should move freely. Tension should start as 3 then adjust +/- as needed.</p> <p>The pressure arms should latch and unlatch smoothly.</p> <p>Adjust or replace as needed.</p>
Coolant Levels	<p>Make sure the power supply is full with coolant before use.</p> <p>Add coolant as needed.</p>
Water / Gas Connections	<p>Check for any cracked or worn fittings on the front and back of feeder.</p> <p>Replace as needed.</p>
Wire Spool Hub	<p>Check wire spool hub tension. Too much tension will cause the wire to slip.</p> <p>Adjust the tension so the spool stops the instant the wire is turned off.</p>

Every 3 Months	
Air clean	Use compressed air to blow out the inside of the feeder.
Oscillator Connecting Rod	<p>Check the connecting rod attached to the oscillator motor for wear and excessive noise</p> <p>Remove 4 screws on the face of the PC Board. Visually inspect and check rod for excessive wear and visual damage. Replace as needed</p>
Bulkhead Dinse Connections	<p>Remove side panel on hotwire module. Check to make sure all dinse connections are tightly secured to the panel mounts.</p> <p>Tightly secure connections to the panel mount.</p>